

# DRAINAGE MEMORANDUM

TO: City of Mercer Island  
 FROM: Ben Iddins, P.E.  
 DATE: February 13, 2024  
 RE: 6520 82<sup>nd</sup> Ave SE, Mercer Island, WA  
 On-site Drainage System Design Summary



This memorandum summarizes the drainage system design in accordance with the 2019 edition of the Washington State Department of Ecology Stormwater Management Manual for Western Washington and the City of Mercer Island Drainage Requirements (the combination of which is hereafter referred to as “the Manual”).

## 1 PROJECT SUMMARY

The site at 6520 82<sup>nd</sup> Ave SE on Mercer Island totals 15,178 square feet and will involve a substantial remodel of the existing single-family residence with the existing foundation to be reused where possible. Four trees will be removed on site as a part of this development. Four trees will be removed during construction. All other trees will be protected to remain (see Attachment F for the full arborist report). The total new plus replaced impervious surfaces is 7,250 square feet. See TABLE 1 for a summary of land cover calculations and Figure 1 for lower portion of driveway that is bypassing the detention system. A summary of the onsite soils is included in the following sections. Since the project will add greater than 5,000 SF of new plus replaced impervious surfaces, it is subject to Minimum Requirements 1 through 9 (outlined in Section I-3.3, Figure 3.3.2 of the Manual).

TABLE 1 Land Cover Summary

	Project Site Areas			
	Existing		Developed	
	SF	Acres	SF	Acres
<b>Impervious Areas:</b>				
Ex House	3,275	0.075		
Ex Driveway	2405	0.055		
Ex Walkways	1030	0.024		
New SFR			4,525	0.104
New Driveway			1,625	0.037
Walkway and Patios			1,100	0.025
<b>Total Onsite Impervious Surface:</b>	<b>6,710</b>	<b>0.154</b>	<b>7,250</b>	<b>0.166</b>
<b>Total New/Replaced Onsite Impervious Surface:</b>			<b>7,250</b>	<b>0.166</b>
<b>Total Onsite Pollution Generating Impervious Surface:</b>	<b>2,405</b>	<b>0.055</b>	<b>1,625</b>	<b>0.037</b>
<b>Total New/Replaced Onsite Pollution Generating Impervious Surface:</b>			<b>1,625</b>	<b>0.037</b>
<b>Total Onsite Pervious Surface:</b>	<b>8,468</b>	<b>0.194</b>	<b>7,928</b>	<b>0.182</b>
Onsite Grass/Landscaping	8,468	0.194	5,572	0.128
Protected Undeveloped Area			2,356	0.054
<b>Total Onsite Project Site Area</b>	<b>15,178</b>	<b>0.348</b>	<b>15,178</b>	<b>0.348</b>

The areas in TABLE 1 were determined by area measurements in AutoCAD from a topographic survey. As shown in TABLE 1, the developed site total impervious surfaces are 7,250 SF, all of which are new and replaced impervious surfaces. The project also proposes 1,625 SF of new plus replaced pollution generating impervious surfaces.

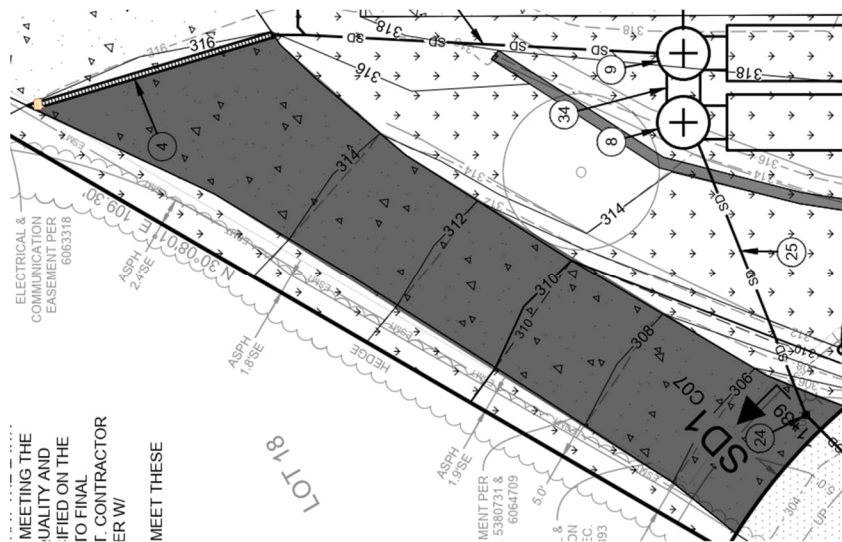


FIGURE 1 Driveway Area Bypassing Detention System

## 2 DRAINAGE SYSTEM

---

The onsite stormwater system is comprised of a Type 1 catch basin, area drains, trench drain, two parallel 60"Ø x 36.5' long detention pipes, Type 2 catch basins, a flow restrictor tee, 4" and 6" SDR35 PVC pipe, and a perforated PVC D2729 footing drain pipe. Stormwater runoff from the upper driveway area will be collected by a trench drain. Stormwater is then routed from the Type 1 catch basin to a Type 2 catch basin associated with the detention facility, which is located west of the driveway. Stormwater runoff from the lower driveway area (too low to gravity-flow to the detention facility), will drain into SE 65<sup>th</sup> St and be collected within the public drainage system. Runoff from the proposed single-family residence will be captured in a gutter and downspout system and conveyed to the Type 2 catch basin associated with the detention facility. Any stormwater collected within the building footing drains will be routed to a 12" area drain which contains a 2' min sump for the settlement of fines. The outlet from this area drain connects to the onsite storm pipes which are routed to the detention facility. See the Drainage Plan in Attachment A for additional details on the proposed drainage system.

All collected stormwater on site will be routed to the detention facility before being conveyed to the public storm main in SE 65<sup>th</sup> St. The detention facility was sized using Table 1 of the City of Mercer Island's Onsite Detention Design Requirements document, which can be seen in Attachment E, since the project is proposing less than 9,500 SF of new plus replaced impervious surface. The total new plus replaced impervious surfaces are 7,250 SF which falls within the 7,000 to 8,000 SF new and replaced impervious surface area range in the detention sizing table. The detention facility will have a pipe diameter of 60" and a total pipe length of 73 ft since the soils on site are classified as Type B soils (see Section 5 and Attachment B for additional soils information). The orifice elevations and dimensions were also determined from Table 1 of the City of Mercer Island's Onsite Detention Design Requirements document which is included in Attachment E.

## 3 LEVEL 1 DOWNSTREAM ANALYSIS

---

Per the Manual, development projects that discharge stormwater offsite shall submit an offsite analysis that assesses the potential off-site water quality, erosion, slope stability, and drainage impacts associated with the project and the appropriate mitigation of those impacts up to 1/4 miles downstream of the site. The Level 1 downstream analysis was performed using the City of Mercer Island GIS Mapping and Google Maps. The drainage path starts with the storm main in 82<sup>nd</sup> Ave SE which flows south west across private property and crosses 81<sup>st</sup> Ave SE and continues west onto private property where it then transitions north where it enters an open water course. This marks the end of the ¼ mile downstream analysis, but flow continues west until it enters Lake Washington. See Exhibit D for Downstream Analysis Map.

## 4 MINIMUM REQUIREMENTS

---

Since the project will add greater than 5,000 SF of new plus replaced impervious surfaces, it is subject to Minimum Requirements #1 through 9 (MR#1-9) in the Manual. The Project meets MR#1-9 as follows:

#### **4.1 MINIMUM REQUIREMENT #1 – STORMWATER SITE PLANS**

The Stormwater Site Plan was prepared in accordance with Volume 3 Chapter 3 of the Manual and includes the minimum requirements applicable to the subject site based on thresholds of new and replaced site impervious coverage.

#### **4.2 MINIMUM REQUIREMENT #2 – CONSTRUCTION STORMWATER POLLUTION PREVENTION**

The Construction Stormwater Pollution Prevention Plan (SWPP) was prepared in accordance with Volume 2 Chapter 2 of the Manual and is described below in Section 6 of this report. The Temporary Erosion and Sediment Control Plan (TESC Plan) can be seen in the Project Plans submitted under separate cover and serves as a guide for the contractor to implement a final TESC Plan. As the site disturbance is less than one acre, a Stormwater Permit is not required.

#### **4.3 MINIMUM REQUIREMENT #3 – SOURCE CONTROL**

The proposed catch basins, spill control elbows, detention facility, area drains with sumps, and cleanouts serve as source control of pollution on the project site. In order to control pollutants, proper maintenance and cleaning of debris, sediment, and oil from stormwater collection and conveyance systems is required per the operation and maintenance recommendations found in Appendix 5-A in Volume 5 of the Manual in addition to the BMPs in Volume 4. See Attachment D for operation and maintenance requirements pertaining to the project.

#### **4.4 MINIMUM REQUIREMENT #4 – PRESERVATION OF NATURAL DRAINAGE SYSTEMS AND OUTFALLS**

The proposed drainage system will emulate the natural pre-developed conditions of the site (i.e., forested conditions) as much as possible as a portion of the undisturbed natural vegetation on the site will remain undisturbed. Stormwater will be detained onsite and discharge from the site will connect to the public drainage system within 82<sup>nd</sup> Ave SE which eventually drains to Lake Washington, thus maintaining the natural drainage course from the site.

#### **4.5 MINIMUM REQUIREMENT #5 – ON-SITE STORMWATER MANAGEMENT**

The On-Site Stormwater Management requirements applicable to this project were determined using List #1. The project complies with List #1 as described below.

##### Lawn and landscaped areas:

All disturbed pervious surfaces will be amended in accordance with the Post-Construction Soil Quality and Depth requirements as listed under BMP T5.13 in Chapter 5 of Volume V.

##### Roof:

1. Full Dispersion is infeasible because the required vegetated flowpath is not available. Downspout Full Infiltration is infeasible because the site is mapped within the “Infiltrating LID facilities are not permitted” area according to Figure 3: Low Impact Development Infiltration Feasibility on Mercer Island Map, which is available online.

2. Bioretention or rain garden facilities are infeasible because the site is mapped within the “Infiltrating LID facilities are not permitted” area according to Figure 3: Low Impact Development Infiltration Feasibility on Mercer Island Map, which is available online.
3. Downspout Dispersion Systems is infeasible because the required vegetated flowpath is not available onsite.
4. Perforated Stub-out Connections is infeasible because the site is mapped within the “Infiltrating LID facilities are not permitted” area according to Figure 3: Low Impact Development Infiltration Feasibility on Mercer Island Map, which is available online.
5. On-site detention will be utilized for the stormwater management of all roof surfaces on site.

#### Other Hard Surfaces:

1. Full dispersion is infeasible because the required vegetated flowpath is not available onsite.
2. Permeable pavement, rain gardens, and bioretention are infeasible because the site is mapped within the “Infiltrating LID facilities are not permitted” area according to Figure 3: Low Impact Development Infiltration Feasibility on Mercer Island Map, which is available online.
3. Sheet flow dispersion and concentrated flow dispersion are infeasible because the required vegetated flowpath is not available onsite and may create issues with the neighboring house downgradient of the site.
4. On-site detention will be utilized for the stormwater management of all non-roof impervious surfaces on-site. A portion of the new driveway (950 SF) will remain unmitigated as stormwater cannot be collected off-site and conveyed to the detention facility via gravity.

Therefore, the Post-Construction Soil Quality and Depth requirements as listed under BMP T5.13 and the detention facility utilized for the impervious surfaces on site satisfies MR#5.

#### **4.6 MINIMUM REQUIREMENT #6: RUNOFF TREATMENT**

This project does not trigger Minimum Requirement #6 since less than 5,000 SF of pollution generating hard surface (PGHS) is proposed.

#### **4.7 MINIMUM REQUIREMENT #7: FLOW CONTROL**

The project does not trigger Minimum Requirement #7 because less than 10,000 SF of effective impervious surfaces is proposed, the project will not convert  $\frac{3}{4}$  acres or more of vegetation to lawn or landscape, and the project will not cause a 0.15 cubic foot per second increase in the 100-year flow frequency from a threshold discharge area (the project site) as estimated using an approved hydrology model (WWHM2012) using 15-minute time steps. Using 15-minute time steps, the predeveloped 100-year flow frequency is 0.0015-cfs and the developed site 100-year flow frequency is 0.0636 cfs, resulting in a 0.0621-cfs increase. See ATTACHEMENT H for the full WWHM2012 modeling report.

#### **4.8 MINIMUM REQUIREMENT #8: WETLANDS PROTECTION**

Per Section 3.4.8 of Volume I of the Manual, the thresholds for Minimum Requirements #6 and #7 apply to Minimum Requirement #8. Since this project does not trigger Minimum Requirement #6 and Minimum Requirement #7, it also does not trigger Minimum Requirement #8. Additionally, this project is not tributary to a wetland.

#### 4.9 MINIMUM REQUIREMENT #9: OPERATION AND MAINTENANCE

An operation and maintenance manual consistent with Volume V of the Stormwater Manual has been provided in Attachment D.

## 5 SOILS

---

A soils investigation was completed by Geotech Consultants Inc, on December 27, 2023. One test pit and several test holes were excavated to exploration depth of approximately 4.5 and 5 feet for the test holes and 10 feet for the test pit. Boring locations and details are summarized in the Geotechnical Report attached as Attachment B.

Subsurface exploration generally encountered a top layer of topsoil, native sand was revealed near the ground surface. Initially, the sand was loose but became medium-dense at depths of approximately 2 to 2.5 feet. The sand then became medium-dense to dense at approximately 3 to 4 feet and became dense with depth. The test pit was excavated to a maximum depth of 10 feet.

Additionally, the site is mapped within the “Infiltrating LID facilities are not permitted” area according to Figure 3: Low Impact Development Infiltration Feasibility on the City of Mercer Island’s online map.

## 6 CONSTRUCTION STORMWATER POLLUTION PREVENTION PLAN (SWPP)

---

The SWPP Plan was prepared in accordance with The Manual. An Erosion and Sediment Control Plan is required per The Manual. Erosion and sediment control (ESC) measures were designed for the project and shown on the TESC plan. Both the SWPP and TESC Plan serve as guides as the contractor is required to design a working TESC plan for the site. The TESC is submitted under separate cover.

Element 1: Preserve Vegetation/Mark Clearing Limits

BMPs used:

- BMP C233: Silt Fence

Silt fence will be placed around the low points of the perimeter of the site.

Element 2: Establish Construction Access

BMPs used:

- BMP C105: Stabilize Construction Entrance/Exit

The project site will have one construction access connecting to SE 65<sup>th</sup> St. The contractor shall install a temporary construction entrance made from quarry spalls. SE 65<sup>th</sup> St and 82<sup>nd</sup> Ave NE will be swept daily, or more frequently as needed, to remove sediment tracked from the project site.

Element 3: Control Flow Rates

BMPs used:

- BMP C235: Wattles

If necessary, the contractor will implement compost socks and/or straw wattles to control flow rates and disperse stormwater.

Element 4: Install Sediment Controls

BMPs used:

- BMP C233: Silt Fence

- BMP C235: Wattles

Silt fencing or straw wattles will be placed along the low points of the perimeter of the construction site to prevent sediment from escaping downstream of the site.

#### Element 5: Stabilize Soils

BMPs used:

- BMP C121: Mulching
- BMP C140: Dust Control

Mulch will be used by the contractor whenever soils will be left exposed for a significant amount of time or whenever a rainfall event is anticipated. During summer months water will be sprinkled on the site as needed to minimize the amount of dust coming off the site.

#### Element 6: Protect Slopes

BMPs used:

- BMP C121 Mulching

Mulch will be added to soils on significant slopes to provide temporary protection from erosion.

#### Element 7: Protect Drain Inlets

BMPs used:

- BMP C220: Storm Drain Inlet Protection

Temporary catch basin inlet protection on all existing catch basins adjacent to the site will be implemented to prevent sediment from entering the drainage system.

#### Element 8: Stabilize Channels and Outlets

N/A. There are no existing roadside ditches and channels which require stabilization

#### Element 9: Control Pollutants

BMPs used:

- BMP C153: Material Delivery, Storage and Containment
- BMP C154: Concrete Washout Area

A material delivery, storage and containment area shall be designated by the contractor and located away from traffic and near the construction entrance. An onsite concrete washout area for any concrete mixing shall be designated by the contractor as well.

#### Element 10: Control De-Watering

BMPs used:

- Water Bars

De-watering should not be an issue on this site as the groundwater table is not known to be near the surface. However, the contractor shall apply water bars during construction as needed.

#### Element 11: Maintain BMPs

BMPs used:

- BMP C150: Materials On Hand
- BMP C160: Certified Erosion and Sediment Control Lead

The contractor shall keep erosion prevention and sediment control materials onsite for regular maintenance and emergency situations. The contractor will be the person in charge of erosion and sediment control for this project.

#### Element 12: Manage the Project

BMPs used:

- BMP C150: Materials On Hand
- BMP C160: Certified Erosion and Sediment Control Lead
- BMP C162: Scheduling

The contractor will be in control of erosion and sediment control and will keep erosion prevention and sediment control materials onsite for regular maintenance and emergency situations. The construction project will be sequenced in an orderly manner to minimize the duration of exposed soil to erosion.

Element 13: Protect Low-Impact Development BMPs

BMPs used:

- BMP C102: Buffer Zone
- BMP C103: High Visibility Fence
- BMP C233: Silt Fence

N/A since LID BMPs are infeasible on the site besides Post-Construction Soil Quality and Depth for landscaped areas. See Section 4.5 of this report for more information on the infeasibility of LID BMPs.

## 7 ATTACHMENTS

---

**ATTACHMENT A – DRAINAGE PLAN**

**ATTACHMENT B – GEOTECHNICAL REPORT**

**ATTACHMENT C – DOWNSTREAM ANALYSIS**


**ATTACHMENT D – OPERATION AND MAINTENANCE MANUAL**

**ATTACHMENT E – DETENTION FACILITY SIZING EXHIBIT**

**ATTACHMENT F – ARBORIST REPORT**

**ATTACHMENT G – WWHM REPORT**

**ATTACHMENT A – DRAINAGE PLAN**

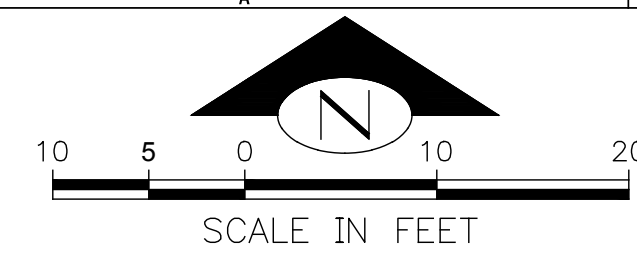

KEY NOTES:		
KEY	NOTE:	DETAIL /SHEET
1	EX TYPE 1 CATCH BASIN RIM 294.18 6" IE (E) 290.15 EX 12" IE (N) 290.08 EX 12" IE (S) 290.13	-
2	SAWCUT AND MATCH EG. REPLACE EX ASPHALT PAVEMENT SECTION IN-KIND	-
3	99 LF 8" SD @ 2.00% MIN	-
4	20 LF 6" TRENCH DRAIN RIM 315.82 6" IE (S) 314.90	-
5	29 LF 4" SD @ 2.00% MIN	-
6	4" SDCO RIM 317.15 4" IE 315.65	E/C08
7	12" AREA DRAIN RIM 319.00 4" IE (E) 316.00 (FTG DRN) 4" IE (W) 316.00 2' MIN SUMP	-
8	54" TYPE 2 CATCH BASIN W/ FLOW CONTROL STRUCTURE RIM 315.19 36" IE (S, E) 309.90 6" IE (SW) 309.90 (OUTLET) FLOW CONTROL STRUCTURE INFO: 6" OVERFLOW ELEV 314.75 ORIFICE #2: 2.0" @ ELEV 314.40 ORIFICE #1: 0.55" @ ELEV 307.90	G/C08 H/C09
9	54" TYPE 2 CATCH BASIN RIM 317.35 4" IE (E) 315.40 6" IE (N) 314.50 36" IE (W) 309.90 36" IE (S) 309.90	G/C08
10	4" SOLID WALL PVC FOOTING DRAIN TIGHTLINE @ 2.00% MIN SLOPE	-
11	4" SDCO RIM 319.10 4" IE 315.50	E/C08
12	5 LF 6" SD @ 2.00% MIN	-
13	41 LF 6" SD @ 1.00% MIN	-
14	DETENTION FACILITY (2) 50 X 36 5/8" PIPE LAID FLAT TOP OF 60" PIPE 314.40 36" IE (N) 309.90 60" IE 309.40	H/C09
15	4" SDCO RIM 317.00± 4" IE 315.91	E/C08
16	47 LF 6" SD @ 1.00% MIN	-
17	ROOF OVERHANG (TYP)	-
18	4" SDCO RIM 318.70± 4" IE 316.38	E/C08
19	PERIMETER FOOTING DRAIN - 4" PERFORATED PVC PIPE IN 6" WASHED GRAVEL WRAPPED IN NON-WOVEN FILTER FABRIC (TYP)	-
20	70 LF 6" SD @ 1.00% MIN	-
21	4" SDCO RIM 319.08 4" IE 317.08	E/C08
22	4" ROOF DOWNSPOUT TIGHTLINE @ 2.00% MIN SLOPE AND 2' MIN COVER	-
23	4" ROOF DOWNSPOUT (TYP)	-
24	6" SDCO RIM 304.75 6" IE 302.25	E/C08
25	26 LF 6" SD @ 2.00% MIN	-
26	35 LF 6" SD @ 1.00% MIN	-
27	5 LF 4" SD @ 2.00% MIN	-
28	TYPE 1 CATCH BASIN W/ SOLID LOCKING LID RIM 302.67 6" IE (NE) 300.00 8" IE (W) 299.00 2' MIN SUMP	F/C08
29	23 LF 6" SD @ 2.00% MIN	-

30	23 LF 4" SD @ 2.00% MIN	-
31	4" SDCO RIM 317.15 4" IE 315.30	E/C08
32	12" AREA DRAIN RIM 319.00 4" IE 317.00	-
33	1 LF 4" SD @ 2.00% MIN	-
34	2 LF 36" SD LAID FLAT @ ELEV 309.90	-
35	3 LF 4" SD @ 2.00% MIN	-
36	12" AREA DRAIN RIM 319.05 4" IE 317.05	-

**DRAINAGE NOTES:**

- ROOF DRAINS:**
- NUMBER AND SIZE SHALL BE IN CONFORMANCE WITH THE UNIFORM PLUMBING CODE.
  - DOWNSPOUTS SHALL BE TIED INTO A NON-PERFORATED, RIGID, SMOOTH-BORE PIPE, WHICH DRAINS TO AN APPROVED STORM SYSTEM.
  - DRAINPIPE SHALL MEET MATERIAL STANDARDS FOR D2729 FOR P.V.C. PIPE, GR F-405 FOR SMOOTH-BORE H.D.P.E. PIPE.
  - PROVIDE CLEANOUTS AT THE UPPER END OF THE SYSTEM AND AT EACH CUMULATIVE CHANGE OF DIRECTION IN EXCESS OF 135 DEGREES.
  - ALL PIPE FITTINGS SHALL BE MADE OF THE SAME MATERIAL AS THE STRAIGHT PIPE. GUEDED JOINTS SHALL USE A BONDING AGENT RECOMMENDED BY THE PIPE MANUFACTURER.

**FOOTING DRAINS:**

- FOOTING DRAINS SHALL BE INSTALLED AROUND ALL FOUNDATIONS WHICH ENCLOSE A CRAWL SPACE, CELLAR, BASEMENT, GARAGE OR OTHER BUILDING SPACE.
- DRAINS SHALL BE CONSTRUCTED OF PERFORATED PIPE INSTALLED AT THE BASE OF THE FOOTING.
- DRAIN PIPE SHALL MEET MATERIAL STANDARDS FOR D2729 FOR P.V.C. PIPE, WITH THE PERFORATIONS DIRECTED DOWNWARD.
- GRANULAR BACKFILL SHALL BE PLACED AROUND AND ABOVE THE FOOTING DRAIN TO A DEPTH OF 2/3 OF THE HEIGHT OF THE WALL.
- A FILTER FABRIC SHALL BE USED TO PREVENT SOIL PARTICLES FROM ENTERING THE FOOTING DRAIN. IT IS PREFERABLE THAT THE FABRIC BE PLACED BETWEEN THE GRANULAR BACKFILL AND THE NATIVE SOILS.

**DRIVEWAY/PARKING AREA DRAINS:**


- LARGE IMPERVIOUS AREAS USED FOR PARKING OR MANEUVERING OF VEHICLES SHALL BE SLOPED TO DRAIN TO ONE OR MORE CATCH BASINS.
- THE BASINS SHALL BE TIED INTO THE ON-SITE STORM DRAINAGE SYSTEM USING NON-PERFORATED PIPE OF THE SAME MATERIALS.
- AT LEAST ONE CATCH BASIN SHALL HAVE AN OIL SEPARATOR TO CLEAN THE WATER, OIL AND SILT PRIOR TO ENTERING THE APPROVED STORM SYSTEM.
- IN AREAS WHERE THE OFF-SITE STORM SYSTEM IS INADEQUATE, ON-SITE DETENTION OF RUNOFF MAY BE REQUIRED. (CONTACT THE DEVELOPMENT ENGINEER FOR MORE INFORMATION).

**GENERAL:**

- SLOPE ALL DRAIN LINES AT 2% MINIMUM TOWARD THE OUTLET.
- PROVIDE CLEANOUTS OR CONTROL STRUCTURES AS APPROPRIATE.
- ALL DRAINAGE PIPING AND STRUCTURES ARE SUBJECT TO INSPECTION PRIOR TO BACKFILLING.
- ROOF AND FOOTING DRAINS MAY BE COMBINED BEYOND THE LOWEST POINT OF THE FOOTING DRAIN.
- USE SAND COLLARS AT CB CONNECTIONS TO P.V.C. PIPE.

**GENERAL (CONTINUED):**

- UNLESS OTHERWISE SPECIFIED, 6" STORM DRAIN PIPE FOR ROOF DRAINS AND SEWER PIPE SHALL BE SDR35 PVC PIPE.
- ALL FOOTING DRAIN AND PERFORATED PIPE SHALL BE D2729 PVC PIPE WITH THE PERFORATIONS DIRECTED DOWNWARD.
- ALL PERF PIPE SHALL BE 4" DIAMETER UNLESS OTHERWISE SHOWN.
- CONTRACTOR TO VERIFY INVERTS OF STORM DRAIN IN ROW AND ADJUST ONSITE STORM SYSTEM AS NECESSARY.
- CONTRACTOR TO FIELD LOCATE AND REROUTE ANY POTENTIAL UTILITY CONFLICTS WITH DETENTION FACILITY PRIOR TO CONSTRUCTION.
- THE LAWN AND LANDSCAPE AREAS ARE REQUIRED TO PROVIDE POST-CONSTRUCTION SOIL QUALITY AND DEPTH IN ACCORDANCE WITH BMP TS.13. THE PROJECT CIVIL ENGINEER MUST PROVIDE A LETTER OF CERTIFICATION TO ENSURE THAT THE LAWN AND LANDSCAPE AREAS ARE MEETING THE POST-CONSTRUCTION SOIL QUALITY AND DEPTH REQUIREMENTS SPECIFIED ON THE APPROVED PLAN SET PRIOR TO FINAL INSPECTION OF THE PROJECT. CONTRACTOR MUST PROVIDE CIVIL ENGINEER W/ INFORMATION PROVING THE POST-CONSTRUCTION SOILS MEET THESE REQUIREMENTS.

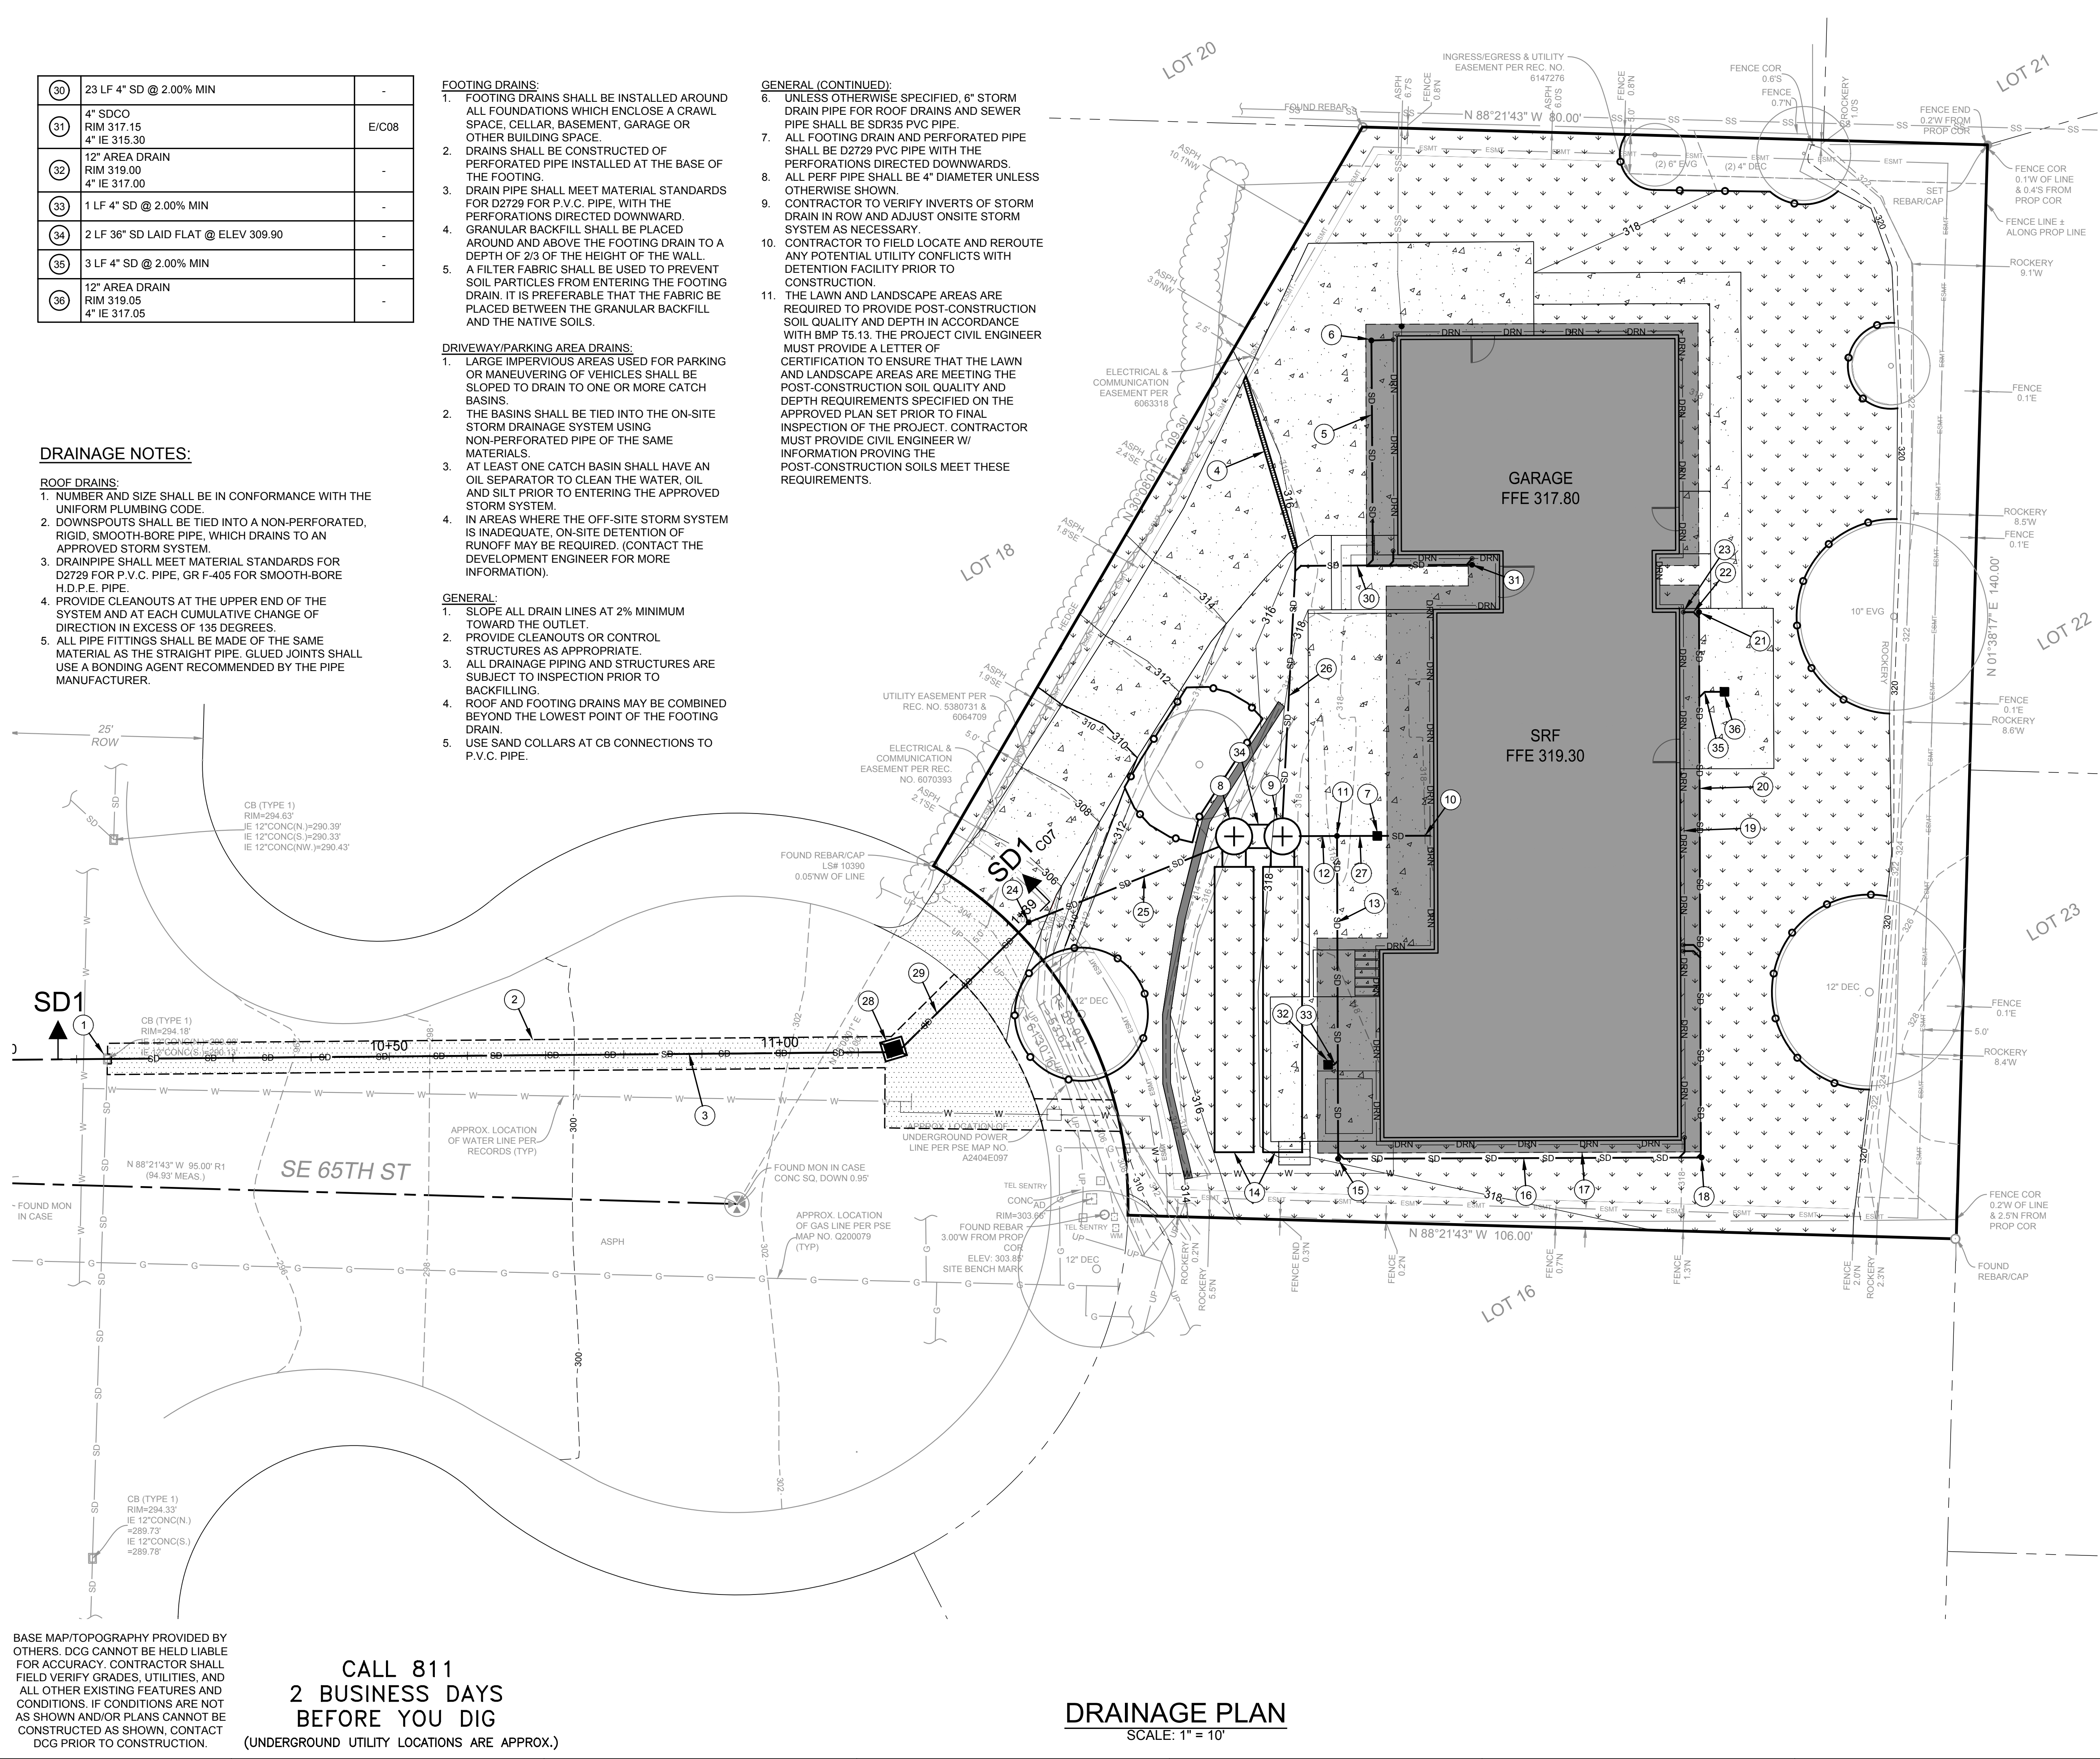

BASE MAP/TPOGRAPHY PROVIDED BY OTHERS. DCG CANNOT BE HELD LIABLE FOR ACCURACY. CONTRACTOR SHALL FIELD VERIFY GRADES, UTILITIES, AND ALL OTHER EXISTING FEATURES AND CONDITIONS. IF CONDITIONS ARE NOT AS SHOWN AND/OR PLANS CANNOT BE CONSTRUCTED AS SHOWN, CONTACT DCG PRIOR TO CONSTRUCTION.

CALL 811  
2 BUSINESS DAYS  
BEFORE YOU DIG  
(UNDERGROUND UTILITY LOCATIONS ARE APPROX.)

**DRAINAGE PLAN**  
SCALE: 1" = 10'

FILE LOCATION: C:\CLIENTS\CELLULAR\ARCHITECTS\6520 82ND AVE SE\MERCER ISLAND\DWG\0200079.DWG, ORIGINAL SHEET SIZE: ARCH FULL BLEED (11.00 X 17.00 INCHES), LAST MODIFIED BY: GERDA SZOZOSZELAJ, PRINCIPAL, BI, PROJECT MANAGER, BI, DESIGNED BY: LG, DRAWN BY: CK, GS, CHECKED BY: BI

**GENERAL NOTES:**


- AS-BUILTS MUST BE TIED TO THE CITY'S HORIZONTAL DATUM.

**LEGEND:**

	CONCRETE
	ASPHALT
	LANDSCAPE

NO.	DATE	BY	REVISION

**DCG WATERSHED**  
9706 4th Ave NE  
Suite 300  
Seattle, WA 98115  
P: 206.523.0024  
www.dcgwatershed.com

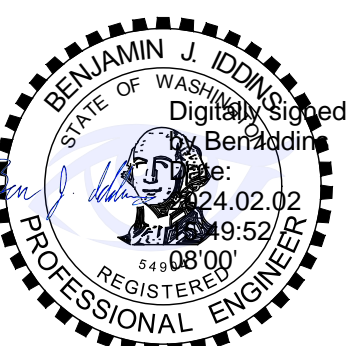

CALL 811  
2 BUSINESS DAYS  
BEFORE YOU DIG  
(UNDERGROUND UTILITY LOCATIONS ARE APPROX.)

**TEKIELA RESIDENCE**  
6520 82ND AVE SE  
MERCER ISLAND, WA 98040  
2311.0333.00

SCHEMATIC PLAN

DRAINAGE PLAN

DATE: 2/2/2024  
PLAN NUMBER:

**C05**  
SHEET 6 OF 9

**ATTACHMENT B – GEOTECHNICAL REPORT**

December 27, 2023

JN 23413

Izabela Tekiela  
5026 – 84<sup>th</sup> Avenue Southeast  
Mercer Island, Washington 98040  
via email: [izabelatekiela@gmail.com](mailto:izabelatekiela@gmail.com)

Subject: **Transmittal Letter – Geotechnical Engineering Study**  
Proposed Residential Project  
6520 – 82<sup>nd</sup> Avenue Southeast  
Mercer Island, Washington

Greetings:

Attached to this transmittal letter is our geotechnical engineering report for the residential project to be constructed on Mercer Island, Washington. The scope of our services consisted of exploring site surface and subsurface conditions, and then developing this report to provide recommendations for general earthwork and geotechnical engineering design considerations for the project. This work was authorized by your acceptance of our proposal, P-11518, dated November 20, 2023.

The attached report contains a discussion of the study and our recommendations. Please contact us if there are any questions regarding this report, or for further assistance during the design and construction phases of this project.

Respectfully submitted,

GEOTECH CONSULTANTS, INC.



D. Robert Ward, P.E.  
Principal

cc: **McClellan Architects** – Joey Pasquinelli  
via email: [joey@mccarch.com](mailto:joey@mccarch.com)

DRW:kg

**GEOTECHNICAL ENGINEERING STUDY**  
**Residential Project**  
**6520 – 82<sup>nd</sup> Avenue Southeast**  
**Mercer Island, Washington**

This report presents the findings and recommendations of our geotechnical engineering study for the site of the proposed residential project to be located at 6520 – 82<sup>nd</sup> Avenue Southeast on Mercer Island.

We were provided with a site plan and main floor plan of the project prepared by McClellan Architects. We also were provided site plans and a topographic map. A one-story residence and attached garage are located in the flat, central portion of the site. We understand that the garage portion will be removed completely, while the foundation of the residence will likely not be removed. A new one-story residence will be located in the same location as the existing residence, but a new detached garage is proposed further north of the existing garage. In addition, some significant patios are proposed on the western/southwestern sides of the residence. The patios may be raised as much as 3 feet above the existing ground.

If the scope of the project changes from what we have described above, we should be provided with revised plans in order to determine if modifications to the recommendations and conclusions of this report are warranted.

**SITE CONDITIONS**

**SURFACE**

The Vicinity Map, Plate 1, illustrates the general location of the southeastern portion of Mercer Island. The site has an irregular, but somewhat rectangular shape, being longest in the north-south direction. It is located east/northeast of the northeast portion of a cul-de-sac driveway that extends east of 82<sup>nd</sup> Avenue Southeast. The site is located in a residential neighborhood and is essentially surrounded by other residential properties.

The overall property slopes down to the west, similar to the surrounding neighborhood. However, the central, majority of the property is nearly flat; the existing one-story residence is located in this flat area. A sloped driveway extends up from the cul-de-sac northeasterly near the western property line that ends in the flat central portion adjacent to the residence; the grade change over this driveway is about 12 vertical feet. Some steep slopes/rockeries mostly line the eastern and western edges of the driveway. The steep slope/rockeries are up to about 8 feet tall at the driveway's northwestern portion and up to about 9 feet at the southeastern portion. In addition to the steep slope/rockery at the southeastern portion of the driveway, there is another small landscape rockery just above it that extends up to the nearly flat central portion of the property. The overall grade change between the flat portion of the property and the base of the driveway slope/rockery is up to approximately 13 feet. We did not observe any instability of these slopes/rockeries during our recent site visits. In addition to the slopes/rockeries on the western portion of the property, there is also an approximate 2- to 4-foot-tall rockery near the eastern property line. It appears there are relatively flat yard/landscape areas of neighboring properties at the top of the rockery. No seeps or springs were observed at the slopes/rockeries, nor anywhere on the site.

The existing residence is a one-story structure that has an attached garage on its northern end. The garage has a slab-on-grade floor, while the living portion of the residence has a crawl space above its main floor. The level of the main floor is one to two feet above the grade around the residence. Using a steel rod, we probed numerous areas around the perimeter of existing residence. Based on these probings, it appears that the residence is supported on a conventional footing foundation. The top of the footing was found to vary from approximately 18 to 30 inches below the existing ground surface. In addition, the outside "lip" of the footing (outside of the foundation wall) varied from approximately 4 to 9 inches. The location of the probings and other information is shown on Plate 2 as discussed further in the subsequent section of this report.

Based on Mercer Island's GIS portal, there are two designated Geologic Hazard Areas at the site, both located at/near the slopes/rockeries on the eastern and western portions of the site. The nearly flat central portion of the site is not a Hazard Area.

## ***SUBSURFACE***

The subsurface conditions were explored by excavating one test pit and several test holes at the approximate locations shown on the Site Exploration Plan, Plate 2. We also used a steel rod to probe conditions/soils in some areas adjacent to the residence foundation (the depth to the top of existing footings and the approximate width of footings using the probe is described in the previous section of this report); the probing locations are also shown on Plate 2. Our exploration program was based on the proposed construction, anticipated subsurface conditions and those encountered during exploration, and the scope of work outlined in our proposal.

The test pit was excavated on December 15, 2023 with a small tracked excavator. A geotechnical engineer from our staff observed the excavation process, logged the test pits, and obtained representative samples of the soil encountered. "Grab" samples of selected subsurface soil were collected from the backhoe bucket. The Test Pit Log is attached to this report as Plate 3. The test holes were hand-excavated by the geotechnical engineer, and their logs are attached as Plate 4.

### **Soil Conditions**

Native soils were revealed in the test pit, test hole, and probings. Generally below a top layer of topsoil, native sand was revealed near the ground surface. Initially, the sand was loose but became medium-dense at depths of approximately 2 to 2.5 feet. The sand then became medium-dense to dense at approximately 3 to 4 feet and became dense with depth. The test pit was excavated to a maximum depth of 10 feet.

No obstructions were revealed by our explorations. However, debris, buried utilities, and old foundation and slab elements are commonly encountered on sites that have had previous development.

### **Groundwater Conditions**

No groundwater seepage was observed in the explorations, nor emanating from the ground at the property. We do not believe that groundwater will be a consideration for this project.

The stratification lines on the logs represent the approximate boundaries between soil types at the exploration locations. The actual transition between soil types may be gradual, and subsurface conditions can vary between exploration locations. The logs provide specific subsurface information

only at the locations tested. The relative densities and moisture descriptions indicated on the test pit/hole logs are interpretive descriptions based on the conditions observed during excavation.

The compaction of test pit backfill was not in the scope of our services. The test pits were backfilled with excavated soil that was lightly tamped into place. Loose soil will therefore be found in the area of the test pits. If this presents a problem, the backfill will need to be removed and replaced with structural fill during construction.

## **CONCLUSIONS AND RECOMMENDATIONS**

### **GENERAL**

*THIS SECTION CONTAINS A SUMMARY OF OUR STUDY AND FINDINGS FOR THE PURPOSES OF A GENERAL OVERVIEW ONLY. MORE SPECIFIC RECOMMENDATIONS AND CONCLUSIONS ARE CONTAINED IN THE REMAINDER OF THIS REPORT. ANY PARTY RELYING ON THIS REPORT SHOULD READ THE ENTIRE DOCUMENT.*

Based on the explorations done in the existing and proposed residence areas of the site, it appears that native, medium-dense sand soil exists at approximately 2 to 2.5 feet below the ground, and the sand becomes medium-dense to dense at approximately 3 to 4 feet. From our several probings around the perimeter of the existing residence, it appears that the top of the footing of the residence varies from approximately 18 to 30 inches below the existing ground surface. Based on this information, and assuming the footings are 6 inches deep (thus 24 to 36 inches below the ground surface), it appears that the existing footings bear on or very near the medium-dense sand soil. The footings, which generally appear to be about 14 inches wide based on the probings and an assumption that the existing foundation wall is 6 inches wide, can be reused if desired provided a relatively low bearing capacity (provided in the **Conventional Footing Foundation** section of this report) is used in the structural design of these existing footings. New footings are also suitable for new structures of the project, although they should bear on the slightly deeper, medium-dense to dense sand. New footings can be designed for a higher bearing capacity, also as noted in the **Conventional Footing Foundation** section of this report.

As noted earlier, based on Mercer Island's GIS portal, there are two designated Geologic Hazard Areas at property; these are located at/near the slopes/rockeries on the eastern and western portions of the site. The nearly flat central portion of the site is not a Hazard Area. A Critical Areas discussion of these areas is given in the subsequent section of this report.

The drainage and/or waterproofing recommendations presented in this report are intended only to prevent active seepage from flowing through concrete walls or slabs. Even in the absence of active seepage into and beneath structures, water vapor can migrate through walls, slabs, and floors from the surrounding soil, and can even be transmitted from slabs and foundation walls due to the concrete curing process. Water vapor also results from occupant uses, such as cooking, cleaning, and bathing. Excessive water vapor trapped within structures can result in a variety of undesirable conditions, including, but not limited to, moisture problems with flooring systems, excessively moist air within occupied areas, and the growth of molds, fungi, and other biological organisms that may be harmful to the health of the occupants. The designer or architect must consider the potential vapor sources and likely occupant uses, and provide sufficient ventilation, either passive or mechanical, to prevent a build up of excessive water vapor within the planned structure.

Geotech Consultants, Inc. should be allowed to review the final development plans to verify that the recommendations presented in this report are adequately addressed in the design. Such a plan review would be additional work beyond the current scope of work for this study, and it may include revisions to our recommendations to accommodate site, development, and geotechnical constraints that become more evident during the review process.

We recommend including this report, in its entirety, in the project contract documents. This report should also be provided to any future property owners so they will be aware of our findings and recommendations.

### **CRITICAL AREAS STUDY (MICC 19.07)**

As noted in the **General** section above, there are two mapped Geologic Hazard Areas at the site. A discussion of each Area is given below:

#### **Potential Landslide Hazard Area:**

Under 19.16.010 of the Mercer Island City Code, a Landslide Hazard is defined as:

*Those areas subject to landslides based on a combination of geologic, topographic, and hydrologic factors, including:*

- 1. Areas of historic failures;*
- 2. Areas with all three of the following characteristics:*
  - a. Slopes steeper than 15 percent; and*
  - b. Hillsides intersecting geologic contacts with a relatively permeable sediment overlying a relatively impermeable sediment or bedrock; and*
  - c. Springs or ground water seepage;*
- 3. Areas that have shown evidence of past movement or that are underlain or covered by mass wastage debris from past movements;*
- 4. Areas potentially unstable because of rapid stream incision and stream bank erosion; or*
- 5. Steep slope. Any slope of 40 percent or greater calculated by measuring the vertical rise over any 30-foot horizontal run.*

Of the above criteria, the only one that applies to the site is 5.; this is at the slope/rockery on the southwestern side of the site. None of the other criteria apply to the site; there is no evidence of historic or past landslide movements, no springs or groundwater seepage, and no rapid stream incision or stream bank erosion.

With regard to the steep slope/rockeries area at the southwestern corner of the property (5.), we strongly believe that the lower rockery was placed in an excavated location and is adjacent to the native, medium-dense and denser sand soil. The small upper rockery is likely supporting fill soil. The residence is founded on the medium-dense sand (no fill) that is at least 2 feet below the ground, and all new building loads (including the proposed patio) will be founded on medium-dense to dense soil as recommended in this report, thus the foundations do/will bear on competent sand soil below the base of the small rockery; thus the small rockery does not provide any stability for the residence and patio structures, and these structures will have no effect on the

stability of the small rockery. The residence is set back about 25 feet from the top of the 9-foot-tall base rockery that is adjacent to competent sand soil, while the patio will be set back about 15 feet. As noted earlier, this rockery appears to be in a stable condition and supports competent sand. The only significant potential of instability would potentially be during an MCE seismic event. However, based on the setback distances, it is our professional opinion that this potential rockery failure would not affect stability of the existing and new structures on the property. Therefore, it is our opinion that no buffers or setbacks are required for the project other than what is currently proposed, provided the recommendations presented in this report are followed. In addition, no adverse conditions will be made on the property or on adjacent properties if the recommendations in this report are followed.

**Erosion Hazard:** The site also meets the City of Mercer Island's criteria for an Erosion Hazard Area. However, the work areas for the proposed work are located where only flat to gently sloped areas and excavations for the project will not be substantial. Thus, typical erosion control measures will be very suitable to suitably control the potential of erosion. One of the most important considerations, particularly during wet weather, is to immediately cover any bare soil areas to prevent accumulated water or runoff from the work area from becoming silty in the first place. A wire-backed silt fence should be erected on the downslope, western side of the property, and the existing vegetation should be left in-place where possible. Straw wattles may also be used in tandem with the silt fence as needed. Also, any soil stockpiles should be covered with plastic during wet weather. Soil stockpiles should be minimized. Following rough grading, it may be necessary to mulch or hydroseed bare areas that will not be immediately covered with landscaping or an impervious surface. The existing driveway can be used as a construction entrance, but any loose soil that reaches the driveway needs to be cleared ASAP.

**Statement of Risk:** In order to satisfy the City of Mercer Island's requirements, a statement of risk is needed. As such, we make the following statement:

*It is our professional opinion that the recommendations presented in this report for the proposed project will render the development as safe as if it were not located in a Geologically Hazardous Area and will not adversely impact adjacent properties.*

## **SEISMIC CONSIDERATIONS**

In accordance with the International Building Code (IBC), the site class within 100 feet of the ground surface is best represented by Site Class Type D (Stiff Soil). As noted in the USGS website, the mapped spectral acceleration value for a 0.2 second ( $S_s$ ) and 1.0 second period ( $S_1$ ) equals 1.46g and 0.51g, respectively.

The IBC and ASCE 7 require that the potential for liquefaction (soil strength loss) during an earthquake be evaluated for the peak ground acceleration of the Maximum Considered Earthquake (MCE), which has a probability of occurring once in 2,475 years (2 percent probability of occurring in a 50-year period). The MCE peak ground acceleration adjusted for site class effects ( $F_{PGA}$ ) equals 0.69g. The soils beneath the site are not susceptible to seismic liquefaction under the ground motions of the MCE because of their dense nature and/or the absence of near-surface groundwater.

Sections 1803.5 of the IBC and 11.8 of ASCE 7 require that other seismic-related geotechnical design parameters (seismic surcharge for retaining wall design and slope stability) include the potential effects of the Design Earthquake. The peak ground acceleration for the Design

Earthquake is defined in Section 11.2 of ASCE 7 as two-thirds (2/3) of the MCE peak ground acceleration, or 0.46g.

### **CONVENTIONAL FOOTING FOUNDATIONS**

As noted earlier in this report, the existing footings can be used to support loads of the proposed residence project. However, a low bearing capacity of 2,000 psf should be used in the design of these footings. Where new footings are needed, they should bear on undisturbed, medium-dense to dens, native sand. An allowable bearing pressure of 3,000 pounds per square foot (psf) is appropriate for the new footings. A one-third increase in this design bearing pressure may be used when considering short-term wind or seismic loads. We recommend that continuous and individual spread footings have minimum widths of 16 and 24 inches, respectively. Exterior footings should also be bottomed at least 18 inches below the lowest adjacent finish ground surface for protection against frost and erosion. The local building codes should be reviewed to determine if different footing widths or embedment depths are required.

Lateral loads due to wind or seismic forces may be resisted by friction between the foundation and the bearing soil, or by passive earth pressure acting on the vertical, embedded portions of the foundation. For the latter condition, the foundation must be either poured directly against relatively level, undisturbed soil or be surrounded by level, well-compacted fill. We recommend using the following ultimate values for the foundation's resistance to lateral loading:

<b>PARAMETER</b>	<b>ULTIMATE VALUE</b>
Coefficient of Friction	0.50
Passive Earth Pressure	300 pcf

**Where: pcf is Pounds per Cubic Foot, and Passive Earth Pressure is computed using the Equivalent Fluid Density.**

If the ground in front of a foundation is loose or sloping, the passive earth pressure given above will not be appropriate. The above ultimate values for passive earth pressure and coefficient of friction do not include a safety factor.

## **FOUNDATION AND RETAINING WALLS**

Retaining walls backfilled on only one side should be designed to resist the lateral earth pressures imposed by the soil they retain. The following recommended parameters are for walls that restrain level backfill:

<b>PARAMETER</b>	<b>VALUE</b>
Lateral Earth Pressure *	35 pcf
Passive Earth Pressure	300 pcf
Coefficient of Friction	0.50
Soil Unit Weight	120 pcf

Where: pcf is Pounds per Cubic Foot, and Lateral and Passive Earth Pressures are computed using the Equivalent Fluid Pressures.

\* For a restrained wall that cannot deflect at least 0.002 times its height, a uniform lateral pressure equal to 10 psf times the height of the wall should be added to the above lateral equivalent fluid pressure. This applies only to walls with level backfill.

The design values given above do not include the effects of any hydrostatic pressures behind the walls and assume that no surcharges, such as those caused by slopes, vehicles, or adjacent foundations will be exerted on the walls. If these conditions exist, those pressures should be added to the above lateral soil pressures. Heavy construction equipment should not be operated behind retaining and foundation walls within a distance equal to the height of a wall, unless the walls are designed for the additional lateral pressures resulting from the equipment.

The values given above are to be used to design only permanent foundation and retaining walls that are to be backfilled, such as conventional walls constructed of reinforced concrete or masonry. It is not appropriate to use the above earth pressures and soil unit weight to back-calculate soil strength parameters for design of other types of retaining walls, such as soldier pile, reinforced earth, modular or soil nail walls. We can assist with design of these types of walls, if desired.

The passive pressure given is appropriate only for a shear key poured directly against undisturbed native soil, or for the depth of level, compacted fill placed in front of a retaining or foundation wall.)) The values for friction and passive resistance are ultimate values and do not include a safety factor. Restrained wall soil parameters should be utilized the wall and reinforcing design for a distance of 1.5 times the wall height from corners or bends in the walls, or from other points of restraint. This is intended to reduce the amount of cracking that can occur where a wall is restrained by a corner.

### **Wall Pressures Due to Seismic Forces**

Per IBC Section 1803.5.12, a seismic surcharge load need only be considered in the design of walls over 6 feet in height. A seismic surcharge load would be imposed by adding a uniform lateral pressure to the above-recommended lateral pressure. The recommended seismic surcharge pressure for this project is  $8H$  pounds per square foot (psf), where  $H$  is the design retention height of the wall. Using this increased pressure, the safety factor against sliding and overturning can be reduced to 1.2 for the seismic analysis.

### **Retaining Wall Backfill and Waterproofing**

Backfill placed behind retaining or foundation walls should be coarse, free-draining structural fill containing no organics. This backfill should contain no more than 5 percent silt or clay particles and have no gravel greater than 4 inches in diameter. The percentage of particles passing the No. 4 sieve should be between 25 and 70 percent. If the native sand is used as backfill, drainage composite similar to Miradrain 6000 should be placed against the backfilled retaining walls. The drainage composites should be hydraulically connected to the foundation drain system. The later section entitled **Drainage Considerations** should also be reviewed for recommendations related to subsurface drainage behind foundation and retaining walls.

The purpose of these backfill requirements is to ensure that the design criteria for a retaining wall are not exceeded because of a build-up of hydrostatic pressure behind the wall. Also, subsurface drainage systems are not intended to handle large volumes of water from surface runoff. The top 12 to 18 inches of the backfill should consist of a compacted, relatively impermeable soil or topsoil, or the surface should be paved. The ground surface must also slope away from backfilled walls at one to 2 percent to reduce the potential for surface water to percolate into the backfill.

Water percolating through pervious surfaces (pavers, gravel, permeable pavement, etc.) must also be prevented from flowing toward walls or into the backfill zone. Foundation drainage and waterproofing systems are not intended to handle large volumes of infiltrated water. The compacted subgrade below pervious surfaces and any associated drainage layer should therefore be sloped away. Alternatively, a membrane and subsurface collection system could be provided below a pervious surface.

It is critical that the wall backfill be placed in lifts and be properly compacted, in order for the above-recommended design earth pressures to be appropriate. The recommended wall design criteria assume that the backfill will be well-compacted in lifts no thicker than 12 inches. The compaction of backfill near the walls should be accomplished with hand-operated equipment to prevent the walls from being overloaded by the higher soil forces that occur during compaction. The section entitled **General Earthwork and Structural Fill** contains additional recommendations regarding the placement and compaction of structural fill behind retaining and foundation walls.

The above recommendations are not intended to waterproof below-grade walls, or to prevent the formation of mold, mildew or fungi in interior spaces. Over time, the performance of subsurface drainage systems can degrade, subsurface groundwater flow patterns can change, and utilities can break or develop leaks. Therefore, waterproofing should be provided where future seepage through the walls is not acceptable. This typically includes limiting cold-joints and wall penetrations, and using bentonite panels or membranes on the outside of the walls. There are a variety of different waterproofing materials and systems, which should be installed by an experienced contractor familiar with the anticipated construction and subsurface conditions. Applying a thin coat of asphalt emulsion to the outside face of a wall is not considered waterproofing, and will only help to reduce moisture generated from water vapor or capillary action from seeping through the concrete. As with any project, adequate ventilation of basement and crawl space areas is important to prevent a buildup of water vapor that is commonly transmitted through concrete walls from the surrounding soil, even when seepage is not present. This is appropriate even when waterproofing is applied to the outside of foundation and retaining walls. We recommend

that you contact an experienced envelope consultant if detailed recommendations or specifications related to waterproofing design, or minimizing the potential for infestations of mold and mildew are desired.

The **General**, **Slabs-On-Grade**, and **Drainage Considerations** sections should be reviewed for additional recommendations related to the control of groundwater and excess water vapor for the anticipated construction.

## **SLABS-ON-GRADE**

The building floors can be constructed as slabs-on-grade atop firm native sand or on structural fill. The subgrade soil must be in a firm, non-yielding condition at the time of slab construction or underslab fill placement. Any soft areas encountered should be excavated and replaced with select, imported structural fill.

Even where the exposed soils appear dry, water vapor will tend to naturally migrate upward through the soil to the newly constructed space above it. This can affect moisture-sensitive flooring, cause imperfections or damage to the slab, or simply allow excessive water vapor into the space above the slab. All interior slabs-on-grade should be underlain by a capillary break drainage layer consisting of a minimum 4-inch thickness of clean gravel or crushed rock that has a fines content (percent passing the No. 200 sieve) of less than 3 percent and a sand content (percent passing the No. 4 sieve) of no more than 10 percent. Pea gravel or crushed rock are typically used for this layer.

As noted by the American Concrete Institute (ACI) in the *Guides for Concrete Floor and Slab Structures*, proper moisture protection is desirable immediately below any on-grade slab that will be covered by tile, wood, carpet, impermeable floor coverings, or any moisture-sensitive equipment or products. ACI recommends a minimum 10-mil thickness vapor retarder for better durability and long term performance than is provided by 6-mil plastic sheeting that has historically been used. A vapor retarder is defined as a material with a permeance of less than 0.3 perms, as determined by ASTM E 96. It is possible that concrete admixtures may meet this specification, although the manufacturers of the admixtures should be consulted. Where vapor retarders are used under slabs, their edges should overlap by at least 6 inches and be sealed with adhesive tape. The sheeting should extend to the foundation walls for maximum vapor protection.

If no potential for vapor passage through the slab is desired, a vapor *barrier* should be used. A vapor barrier, as defined by ACI, is a product with a water transmission rate of 0.01 perms when tested in accordance with ASTM E 96. Reinforced membranes having sealed overlaps can meet this requirement.

We recommend that the contractor, the project materials engineer, and the owner discuss these issues and review recent ACI literature and ASTM E-1643 for installation guidelines and guidance on the use of the protection/blotter material.

The **General**, **Permanent Foundation and Retaining Walls**, and **Drainage Considerations** sections should be reviewed for additional recommendations related to the control of groundwater and excess water vapor for the anticipated construction.

## **EXCAVATIONS AND SLOPES**

Temporary excavation slopes should not exceed the limits specified in local, state, and national government safety regulations. Also, temporary cuts should be planned to provide a minimum 2 to 3 feet of space for construction of foundations, walls, and drainage. Temporary cuts to a maximum overall depth of about 4 feet may be attempted vertically in unsaturated soil, if there are no indications of slope instability. However, vertical cuts should not be made near property boundaries, or existing utilities and structures. Based upon Washington Administrative Code (WAC) 296, Part N, the soil at the subject site would generally be classified as Type B. Therefore, temporary cut slopes greater than 4 feet in height should not be excavated at an inclination steeper than 1:1 (Horizontal:Vertical), extending continuously between the top and the bottom of a cut.

The above-recommended temporary slope inclination is based on the conditions exposed in our explorations, and on what has been successful at other sites with similar soil conditions. It is possible that variations in soil and groundwater conditions will require modifications to the inclination at which temporary slopes can stand. Temporary cuts are those that will remain unsupported for a relatively short duration to allow for the construction of foundations, retaining walls, or utilities. Temporary cut slopes should be protected with plastic sheeting during wet weather. It is also important that surface runoff be directed away from the top of temporary slope cuts. Cut slopes should also be backfilled or retained as soon as possible to reduce the potential for instability. Please note that sand can cave suddenly and without warning. Excavation, foundation, and utility contractors should be made especially aware of this potential danger. These recommendations may need to be modified if the area near the potential cuts has been disturbed in the past by utility installation, or if settlement-sensitive utilities are located nearby.

Water should not be allowed to flow uncontrolled over the top of any temporary or permanent slope. All permanently exposed slopes should be seeded with an appropriate species of vegetation to reduce erosion and improve the stability of the surficial layer of soil.

## **DRAINAGE CONSIDERATIONS**

Footing drains are only needed where: (1) crawl spaces or basements will be below a structure; (2) a slab is below the outside grade; or, (3) the outside grade does not slope downward from a building. Drains should also be placed at the base of all earth-retaining walls. These drains should be surrounded by at least 6 inches of 1-inch-minus, washed rock that is encircled with non-woven, geotextile filter fabric (Mirafi 140N, Supac 4NP, or similar material). At its highest point, a perforated pipe invert should be at least 6 inches below the bottom of a slab floor or the level of a crawl space. The discharge pipe for subsurface drains should be sloped for flow to the outlet point. Roof and surface water drains must not discharge into the foundation drain system. For the best long-term performance, perforated PVC pipe is recommended for all subsurface drains. Clean-outs should be provided for potential future flushing or cleaning of footing drains.

As a minimum, a vapor retarder, as defined in the **Slabs-On-Grade** section, should be provided in any crawl space area to limit the transmission of water vapor from the underlying soils. Crawl space grades are sometimes left near the elevation of the bottom of the footings. As a result, an outlet drain is recommended for all crawl spaces to prevent an accumulation of any water that may bypass the footing drains. Providing a few inches of free draining gravel underneath the vapor retarder is also prudent to limit the potential for seepage to build up on top of the vapor retarder.

The excavation and site should be graded so that surface water is directed off the site and away from the tops of slopes. Water should not be allowed to stand in any area where foundations, slabs, or pavements are to be constructed. Final site grading in areas adjacent to the residence and garage should slope away at least one to 2 percent, except where the area is paved. Surface drains should be provided where necessary to prevent ponding of water behind foundation or retaining walls. A discussion of grading and drainage related to pervious surfaces near walls and structures is contained in the **Foundation and Retaining Walls** section.

### **GENERAL EARTHWORK AND STRUCTURAL FILL**

All building and pavement areas should be stripped of surface vegetation, topsoil, organic soil, and other deleterious material. The stripped or removed materials should not be mixed with any materials to be used as structural fill, but they could be used in non-structural areas, such as landscape beds.

Structural fill is defined as any fill, including utility backfill, placed under, or close to, a building, or in other areas where the underlying soil needs to support loads. All structural fill should be placed in horizontal lifts with a moisture content at, or near, the optimum moisture content. The optimum moisture content is that moisture content that results in the greatest compacted dry density. The moisture content of fill is very important and must be closely controlled during the filling and compaction process.

The allowable thickness of the fill lift will depend on the material type selected, the compaction equipment used, and the number of passes made to compact the lift. The loose lift thickness should not exceed 12 inches, but should be thinner if small, hand-operated compactors are used. We recommend testing structural fill as it is placed. If the fill is not sufficiently compacted, it should be recompacted before another lift is placed. This eliminates the need to remove the fill to achieve the required compaction. The following table presents recommended levels of relative compaction for compacted fill:

<b>LOCATION OF FILL PLACEMENT</b>	<b>MINIMUM RELATIVE COMPACTION</b>
Beneath slabs or walkways	92%
Filled slopes and behind retaining walls	90%
Beneath pavements	95% for upper 12 inches of subgrade; 90% below that level

**Where: Minimum Relative Compaction is the ratio, expressed in percentages, of the compacted dry density to the maximum dry density, as determined in accordance with ASTM Test Designation D 1557-91 (Modified Proctor).**

### **LIMITATIONS**

The conclusions and recommendations contained in this report are based on site conditions as they existed at the time of our exploration and assume that the soil and groundwater conditions encountered in the test pit are representative of subsurface conditions on the site. If the subsurface conditions encountered during construction are significantly different from those observed in our

explorations, we should be advised at once so that we can review these conditions and reconsider our recommendations where necessary. Unanticipated conditions are commonly encountered on construction sites and cannot be fully anticipated by merely taking samples in test pit. Subsurface conditions can also vary between exploration locations. Such unexpected conditions frequently require making additional expenditures to attain a properly constructed project. It is recommended that the owner consider providing a contingency fund to accommodate such potential extra costs and risks. This is a standard recommendation for all projects.

This report has been prepared for the exclusive use of Izabela Tekiela and her representatives for specific application to this project and site. Our conclusions and recommendations are professional opinions derived in accordance with our understanding of current local standards of practice, and within the scope of our services. No warranty is expressed or implied. The scope of our services does not include services related to construction safety precautions, and our recommendations are not intended to direct the contractor's methods, techniques, sequences, or procedures, except as specifically described in our report for consideration in design. Our services also do not include assessing or minimizing the potential for biological hazards, such as mold, bacteria, mildew and fungi in either the existing or proposed site development.

### **ADDITIONAL SERVICES**

In addition to reviewing the final plans, Geotech Consultants, Inc. should be retained to provide geotechnical consultation, testing, and observation services during construction. This is to confirm that subsurface conditions are consistent with those indicated by our exploration, to evaluate whether earthwork and foundation construction activities comply with the general intent of the recommendations presented in this report, and to provide suggestions for design changes in the event subsurface conditions differ from those anticipated prior to the start of construction. However, our work would not include the supervision or direction of the actual work of the contractor and its employees or agents. Also, job and site safety, and dimensional measurements, will be the responsibility of the contractor.

During the construction phase, we will provide geotechnical observation and testing services when requested by you or your representatives. Please be aware that we can only document site work we actually observe. It is still the responsibility of your contractor or on-site construction team to verify that our recommendations are being followed, whether we are present at the site or not.

The following plates are attached to complete this report:

Plate 1	Vicinity Map
Plate 2	Site Exploration Plan
Plates 3 - 4	Test Pit and Test Hole Logs

We appreciate the opportunity to be of service on this project. Please contact us if you have any questions, or if we can be of further assistance.

Respectfully submitted,

GEOTECH CONSULTANTS, INC.





12/27/2023

D. Robert Ward, P.E.  
Principal

DRW:kg

**NORTH**

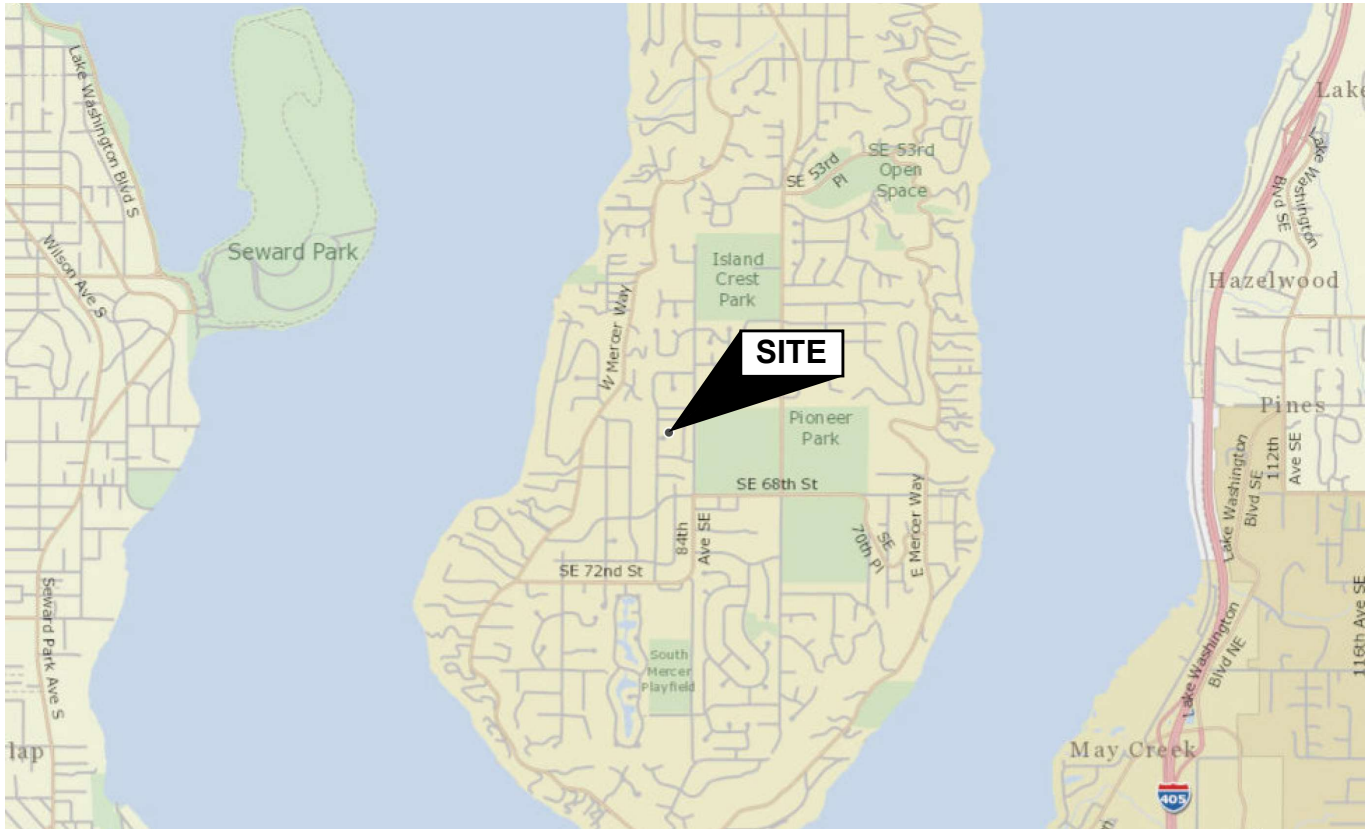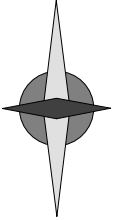

(Source: King County iMap)



**GEOTECH**  
CONSULTANTS, INC.

**VICINITY MAP**  
6520 - 82nd Avenue Southeast  
Mercer Island, Washington


<b>Job No:</b> 23413	<b>Date:</b> Dec. 2023	<b>Plate:</b> 1
-------------------------	---------------------------	--------------------



# TEST PIT 1

Depth (ft.)  
Moisture  
Content (%)  
Water  
Table  
USCS

Description

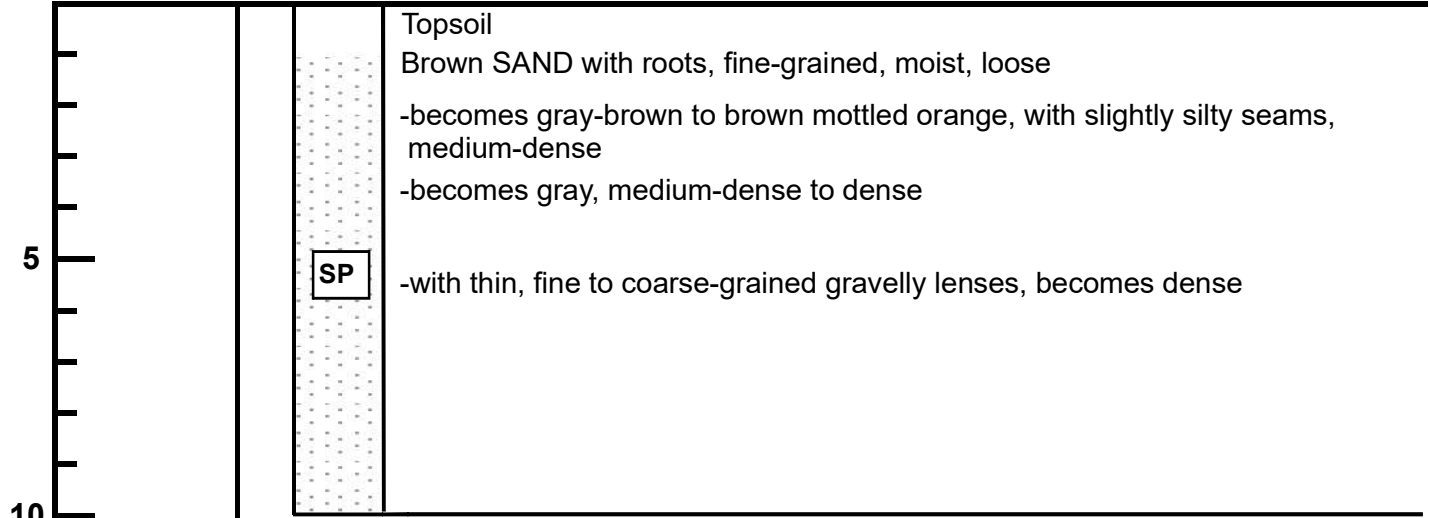

- \* Test Pit terminated at 10 feet on December 15, 2023.
- \* No groundwater seepage was observed during excavation.
- \* No caving observed during excavation.




**TEST PIT LOG**  
6520 - 82nd Avenue Southeast  
Mercer Island, Washington

<b>Job No:</b> 23413	<b>Date:</b> Dec. 2023	<b>Plate:</b> 3
-------------------------	---------------------------	--------------------

# TEST HOLE 1

Depth (ft.)  
Moisture  
Content (%)  
Water  
Table  
USCS


Description

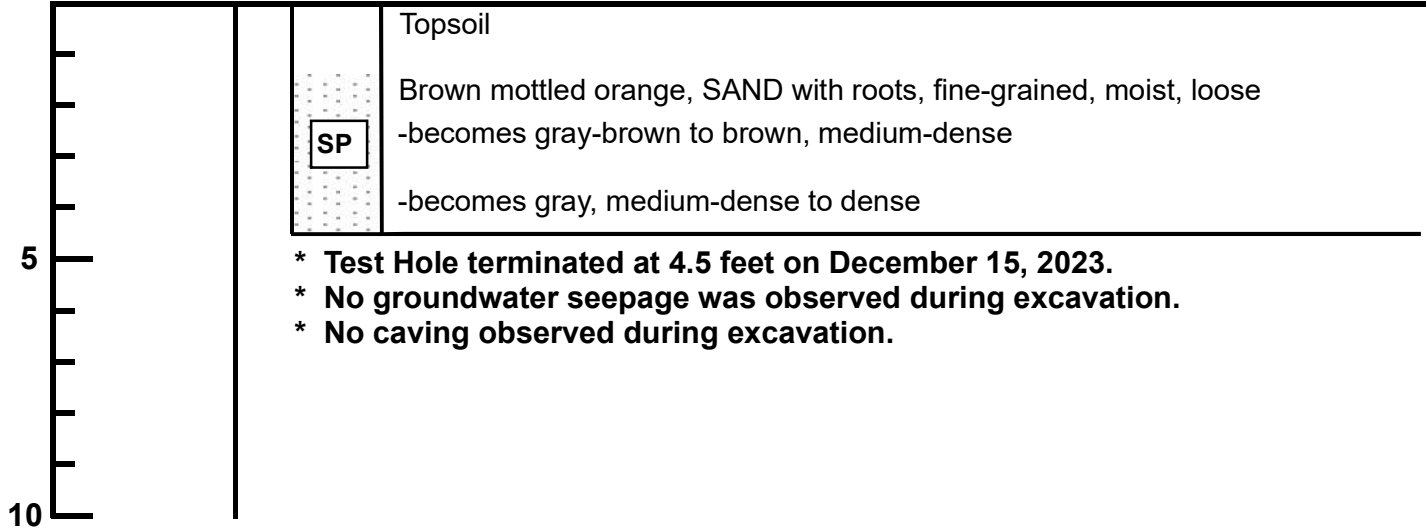

# TEST HOLE 2

Depth (ft.)  
Moisture  
Content (%)  
Water  
Table  
USCS

Description

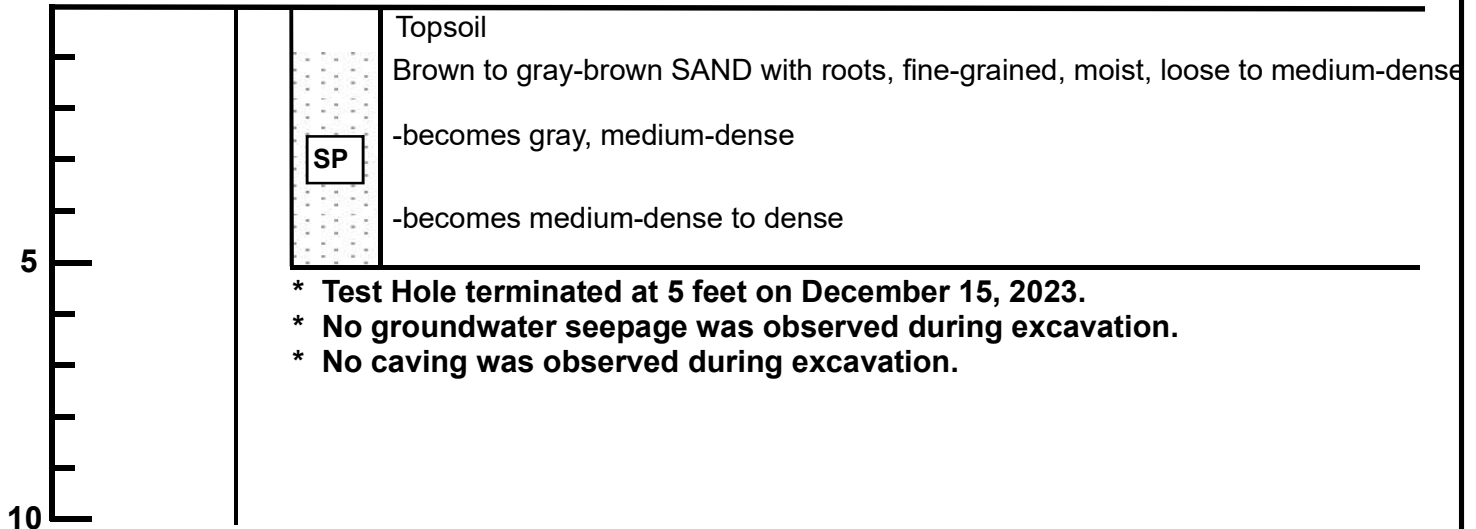


**TEST HOLE LOGS**  
6520 - 82nd Avenue Southeast  
Mercer Island, Washington

<b>Job No:</b> 23413	<b>Date:</b> Dec. 2023	<b>Plate:</b> 4
-------------------------	---------------------------	--------------------

**ATTACHMENT C – DOWNSTREAM ANALYSIS MAP**


# City of Mercer Island

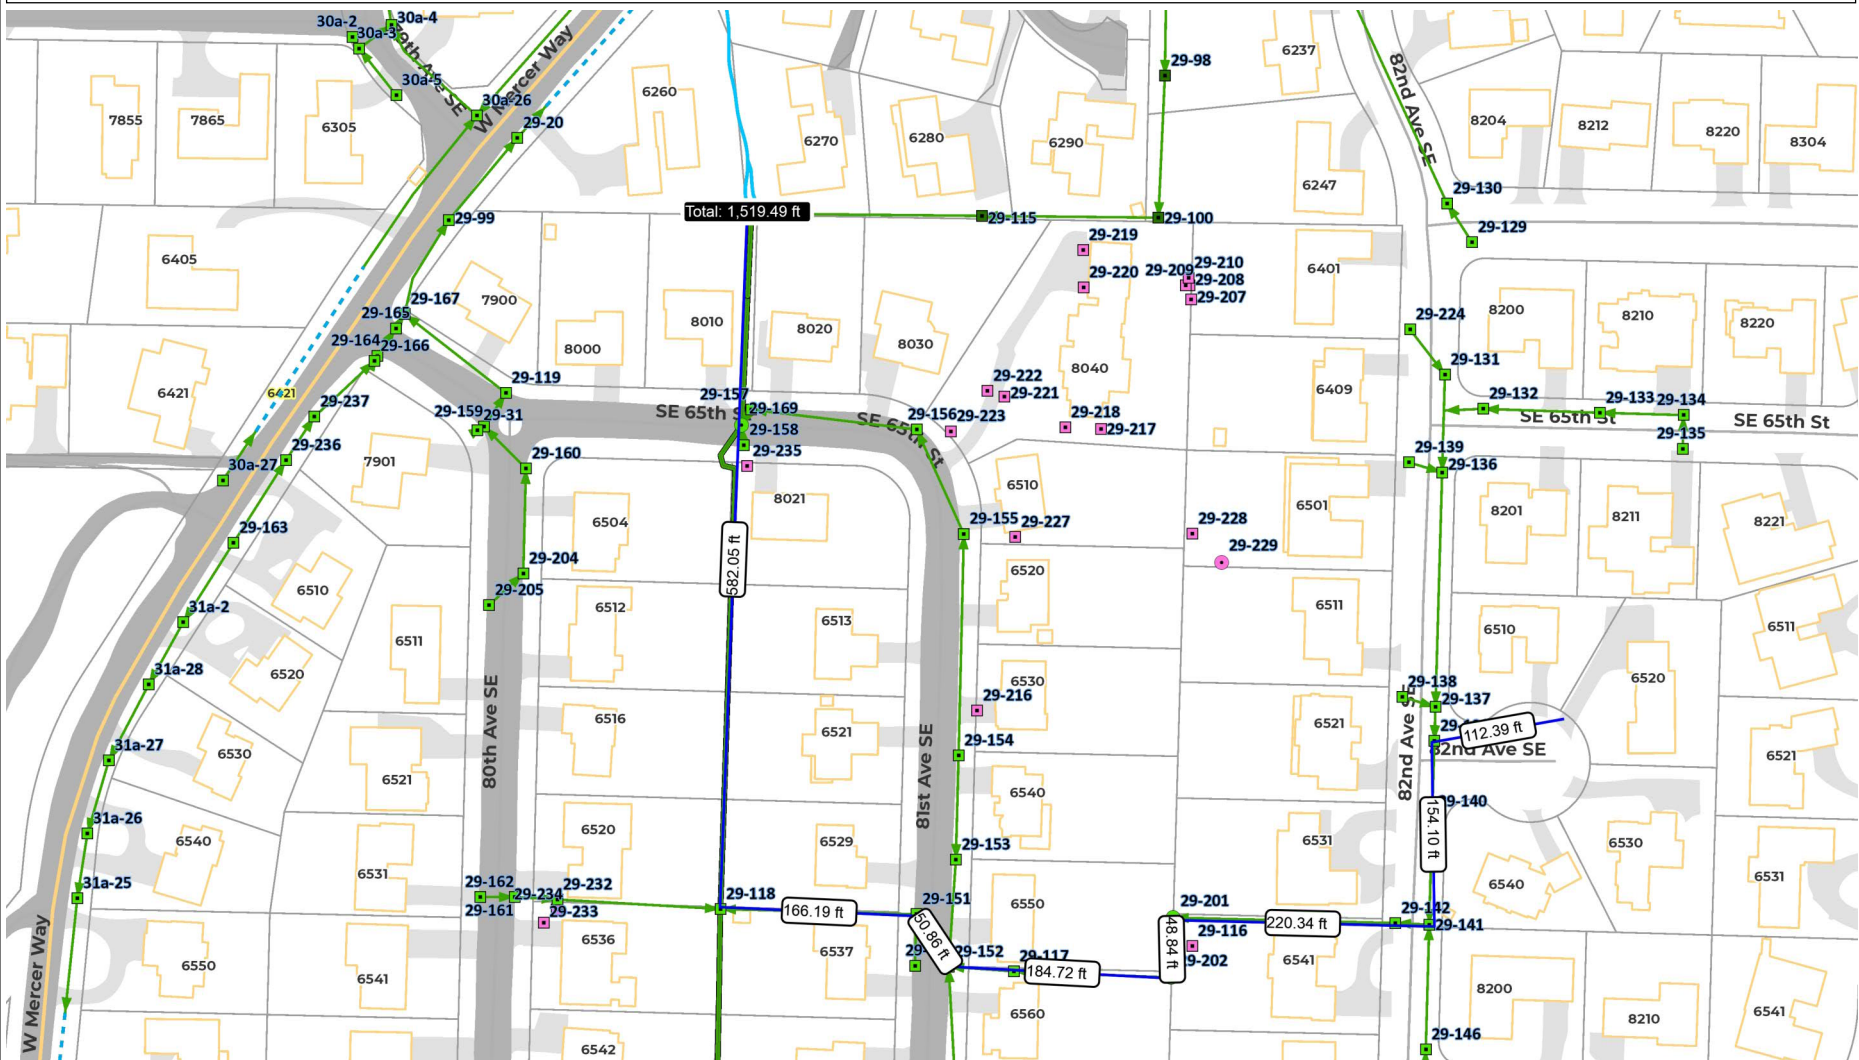

**Legend**

- Storm Catch Basin
  - CB, City Owned
  - CB, Private
  - CB, Unknown
  - Type 2, City Owned
  - Type 2, Private
  - Type 2, Unknown
- Storm Main
  - Pipe
  - Open Watercourse
  - Piped Watercourse
  - Ditch
  - Culvert
  - Other
- Storm Main - Private
- Storm Discharge Point
- Address
- Building
- Property Line
- Docks
- Freeway
- Major Street
- Street
- Paved Driveway
- Paved Road
- Paved Parking Area
- Parks
- Lake Washington

1: 1,250



**Disclaimer:** These maps were developed by the City of Mercer Island and are intended to be a general purpose digital reference tool. These maps are not an accepted legal instrument for describing, establishing, recording or maintaining descriptions for property concerns or boundaries. The City makes no representation or warranty with respect to the accuracy or currency of these data sets, especially in regard to labeling of surveyed dimensions, or agreement with official sources such as records of survey, or mapped locations of features.

**Notes**

## **ATTACHMENT D – OPERATION AND MAINTENANCE MANUAL**

# **6520 82nd Ave SE**

## **Operation and Maintenance Manual**

### **Person or Organization Responsible for Maintenance of the On-Site Storm System:**

Robert & Izabela Tekiela  
6520 82<sup>nd</sup> Ave SE  
Mercer Island, WA 98040

### **The Location Where the Operation and Maintenance Manual is to be Kept:**

6520 82nd Ave SE  
Mercer Island, WA 98040

\*Note: The manual and maintenance activity log must be made available to the City of Mercer Island for inspection purposes.

### **Description of On-Site Storm System**

The on-site storm system for 6520 82<sup>nd</sup> Ave SE consists of 4-36" conveyance pipe, 60" detention facilities, 12" area drain, Type 1 catch basin and a Type 2 catch basins.

Stormwater runoff from the driveway will be collected by a Type 1 catch basin. Stormwater is then routed from the Type 1 catch basin to a Type 2 catch basin associated with the detention facilities. Likewise, runoff from the proposed single-family residence will be captured in a gutter and downspout system and conveyed to the Type 2 catch basin and then the detention facility. Any stormwater collected within the building footing drains will also be routed to an area drain which contains a 2' min sump for the settlement of fines and then routed to the Type 2 catch basin. All collected stormwater on site will be routed to the detention facility before being conveyed to the public storm main.

The Type I catch basin, (2) Type 2 catch basin, (2) 36.5 LF 60" detention facility, 12" area drain, and storm drain cleanouts serve as source control of pollution for the project site. In order to control pollutants, proper maintenance and cleaning of debris, sediments, and oil from stormwater collection and conveyance systems is required per the operation and maintenance recommendations found in Volume 5 Section 4.6 of the Stormwater Manual in addition to the BMPs in Volume IV Section 2.2. See the attached sheets for operation and maintenance requirements pertaining to the project.

## **Contact Information for Stormwater Facility Manufacturers and Installers:**

### Contractor (Installer of On-Site Stormwater Facilities)

TBD

### Civil Engineer (Designer of On-Site Stormwater Facilities)

Ben Iddins, P.E.

DCG/Watershed

9706 4th Ave NE, Suite 300

Seattle, WA 98115

Phone – 206.523.0024 Ext. 115

[ben@dcgengr.com](mailto:ben@dcgengr.com)

### Attachments

- Maintenance Standards for Closed Detention Systems (2019 DOE Manual)
- Maintenance Standards for Control Structure/Flow Restrictor (2019 DOE Manual)
- Maintenance Standards for Catch Basins (2019 DOE Manual)

**Table V-A.2: Maintenance Standards - Infiltration (continued)**

Maintenance Component	Defect	Conditions When Maintenance Is Needed	Results Expected When Maintenance Is Performed
		(A percolation test pit or test of facility indicates facility is only working at 90% of its designed capabilities. Test every 2 to 5 years. If two inches or more sediment is present, remove).	
Filter Bags (if applicable)	Filled with Sediment and Debris	Sediment and debris fill bag more than 1/2 full.	Filter bag is replaced or system is redesigned.
Rock Filters	Sediment and Debris	By visual inspection, little or no water flows through filter during heavy rain storms.	Gravel in rock filter is replaced.
Side Slopes of Pond	Erosion	See <a href="#">Table V-A.1: Maintenance Standards - Detention Ponds</a>	See <a href="#">Table V-A.1: Maintenance Standards - Detention Ponds</a>
Emergency Overflow Spillway and Berms over 4 feet in height.	Tree Growth	See <a href="#">Table V-A.1: Maintenance Standards - Detention Ponds</a>	See <a href="#">Table V-A.1: Maintenance Standards - Detention Ponds</a>
	Piping	See <a href="#">Table V-A.1: Maintenance Standards - Detention Ponds</a>	See <a href="#">Table V-A.1: Maintenance Standards - Detention Ponds</a>
Emergency Overflow Spillway	Rock Missing	See <a href="#">Table V-A.1: Maintenance Standards - Detention Ponds</a>	See <a href="#">Table V-A.1: Maintenance Standards - Detention Ponds</a>
	Erosion	See <a href="#">Table V-A.1: Maintenance Standards - Detention Ponds</a>	See <a href="#">Table V-A.1: Maintenance Standards - Detention Ponds</a>
Pre-settling Ponds and Vaults	Facility or sump filled with Sediment and/or debris	6" or designed sediment trap depth of sediment.	Sediment is removed.

**Table V-A.3: Maintenance Standards - Closed Detention Systems (Tanks/Vaults)**

Maintenance Component	Defect	Conditions When Maintenance is Needed	Results Expected When Maintenance is Performed
Storage Area	Plugged Air Vents	One-half of the cross section of a vent is blocked at any point or the vent is damaged.	Vents open and functioning.
	Debris and Sediment	Accumulated sediment depth exceeds 10% of the diameter of the storage area for 1/2 length of storage vault or any point depth exceeds 15% of diameter. (Example: 72-inch storage tank would require cleaning when sediment reaches depth of 7 inches for more than 1/2 length of tank.)	All sediment and debris removed from storage area.
	Joints Between Tank/Pipe Section	Any openings or voids allowing material to be transported into facility. (Will require engineering analysis to determine structural stability).	All joint between tank/pipe sections are sealed.
	Tank Pipe Bent Out of Shape	Any part of tank/pipe is bent out of shape more than 10% of its design shape. (Review required by engineer to determine structural stability).	Tank/pipe repaired or replaced to design.
	Vault Structure Includes Cracks in Wall, Bottom, Damage to Frame and/or Top Slab	Cracks wider than 1/24-inch and any evidence of soil particles entering the structure through the cracks, or maintenance/inspection personnel determines that the vault is not structurally sound. Cracks wider than 1/2-inch at the joint of any inlet/outlet pipe or any evidence of soil particles entering the vault through the walls.	Vault replaced or repaired to design specifications and is structurally sound. No cracks more than 1/4-inch wide at the joint of the inlet/outlet pipe.

**Table V-A.3: Maintenance Standards - Closed Detention Systems (Tanks/Vaults) (continued)**

Maintenance Component	Defect	Conditions When Maintenance is Needed	Results Expected When Maintenance is Performed
Manhole	Cover Not in Place	Cover is missing or only partially in place. Any open manhole requires maintenance.	Manhole is closed.
	Locking Mechanism Not Working	Mechanism cannot be opened by one maintenance person with proper tools. Bolts into frame have less than 1/2 inch of thread (may not apply to self-locking lids).	Mechanism opens with proper tools.
	Cover Difficult to Remove	One maintenance person cannot remove lid after applying normal lifting pressure. Intent is to keep cover from sealing off access to maintenance.	Cover can be removed and reinstalled by one maintenance person.
	Ladder Rungs Unsafe	Ladder is unsafe due to missing rungs, misalignment, not securely attached to structure wall, rust, or cracks.	Ladder meets design standards. Allows maintenance person safe access.
Catch Basins	See <a href="#">Table V-A.5: Maintenance Standards - Catch Basins</a>	See <a href="#">Table V-A.5: Maintenance Standards - Catch Basins</a>	See <a href="#">Table V-A.5: Maintenance Standards - Catch Basins</a>

**Table V-A.4: Maintenance Standards - Control Structure/Flow Restrictor**

Maintenance Component	Defect	Condition When Maintenance is Needed	Results Expected When Maintenance is Performed
General	Trash and Debris (Includes Sediment)	Material exceeds 25% of sump depth or 1 foot below orifice plate.	Control structure orifice is not blocked. All trash and debris removed.
	Structural Damage	Structure is not securely attached to manhole wall. Structure is not in upright position (allow up to 10% from plumb). Connections to outlet pipe are not watertight and show signs of rust. Any holes - other than designed holes - in the structure.	Structure securely attached to wall and outlet pipe. Structure in correct position. Connections to outlet pipe are water tight; structure repaired or replaced and works as designed. Structure has no holes other than designed holes.
Cleanout Gate	Damaged or Missing	Cleanout gate is not watertight or is missing. Gate cannot be moved up and down by one maintenance person. Chain/rod leading to gate is missing or damaged. Gate is rusted over 50% of its surface area.	Gate is watertight and works as designed. Gate moves up and down easily and is watertight. Chain is in place and works as designed. Gate is repaired or replaced to meet design standards.
Orifice Plate	Damaged or Missing	Control device is not working properly due to missing, out of place, or bent orifice plate.	Plate is in place and works as designed.
	Obstructions	Any trash, debris, sediment, or vegetation blocking the plate.	Plate is free of all obstructions and works as designed.
Overflow Pipe	Obstructions	Any trash or debris blocking (or having the potential of blocking) the overflow pipe.	Pipe is free of all obstructions and works as designed.
Manhole	See <a href="#">Table V-A.3: Maintenance Standards - Closed Detention Systems (Tanks/Vaults)</a>	See <a href="#">Table V-A.3: Maintenance Standards - Closed Detention Systems (Tanks/Vaults)</a>	See <a href="#">Table V-A.3: Maintenance Standards - Closed Detention Systems (Tanks/Vaults)</a>
Catch Basin	See <a href="#">Table V-A.5: Maintenance Standards - Catch Basins</a>	See <a href="#">Table V-A.5: Maintenance Standards - Catch Basins</a>	See <a href="#">Table V-A.5: Maintenance Standards - Catch Basins</a>

**Table V-A.5: Maintenance Standards - Catch Basins**

Maintenance Component	Defect	Conditions When Maintenance is Needed	Results Expected When Maintenance is performed
General	Trash & Debris	Trash or debris which is located immediately in front of the catch basin opening or is blocking inletting capacity of the basin by more than 10%. Trash or debris (in the basin) that exceeds 60 percent of the sump depth as measured from the bottom of basin to invert of the lowest pipe into or out of the basin, but in no case less than a minimum of six inches clearance from the debris surface to the invert of the lowest pipe. Trash or debris in any inlet or outlet pipe blocking more than 1/3 of its height. Dead animals or vegetation that could generate odors that could cause complaints or dangerous gases (e.g., methane).	No Trash or debris located immediately in front of catch basin or on grate opening. No trash or debris in the catch basin. Inlet and outlet pipes free of trash or debris. No dead animals or vegetation present within the catch basin.
	Sediment	Sediment (in the basin) that exceeds 60 percent of the sump depth as measured from the bottom of basin to invert of the lowest pipe into or out of the basin, but in no case less than a minimum of 6 inches clearance from the sediment surface to the invert of the lowest pipe.	No sediment in the catch basin
	Structure Damage to Frame and/or Top Slab	Top slab has holes larger than 2 square inches or cracks wider than 1/4 inch. (Intent is to make sure no material is running into basin). Frame not sitting flush on top slab, i.e., separation of more than 3/4 inch of the frame from the top slab. Frame not securely attached	Top slab is free of holes and cracks. Frame is sitting flush on the riser rings or top slab and firmly attached.
	Fractures or Cracks in Basin Walls/ Bottom	Maintenance person judges that structure is unsound. Grout fillet has separated or cracked wider than 1/2 inch and longer than 1 foot at the joint of any inlet/outlet pipe or any evidence of soil particles entering catch basin through cracks.	Basin replaced or repaired to design standards. Pipe is regouted and secure at basin wall.
	Settlement/ Mis-alignment	If failure of basin has created a safety, function, or design problem.	Basin replaced or repaired to design standards.
	Vegetation	Vegetation growing across and blocking more than 10% of the basin opening. Vegetation growing in inlet/outlet pipe joints that is more than six inches tall and less than six inches apart.	No vegetation blocking opening to basin. No vegetation or root growth present.
	Contamination and Pollution	See <a href="#">Table V-A.1: Maintenance Standards - Detention Ponds</a>	No pollution present.
Catch Basin Cover	Cover Not in Place	Cover is missing or only partially in place. Any open catch basin requires maintenance.	Cover/grate is in place, meets design standards, and is secured
	Locking Mechanism Not Working	Mechanism cannot be opened by one maintenance person with proper tools. Bolts into frame have less than 1/2 inch of thread.	Mechanism opens with proper tools.
	Cover Difficult to Remove	One maintenance person cannot remove lid after applying normal lifting pressure. (Intent is keep cover from sealing off access to maintenance.)	Cover can be removed by one maintenance person.
Ladder	Ladder Rungs Unsafe	Ladder is unsafe due to missing rungs, not securely attached to basin wall, misalignment, rust, cracks, or sharp edges.	Ladder meets design standards and allows maintenance person safe access.
Metal Grates (If Applicable)	Grate opening Unsafe	Grate with opening wider than 7/8 inch.	Grate opening meets design standards.
	Trash and Debris	Trash and debris that is blocking more than 20% of grate surface inletting capacity.	Grate free of trash and debris.
	Damaged or Missing.	Grate missing or broken member(s) of the grate.	Grate is in place, meets the design standards, and is installed and aligned with the flow path.

**ATTACHMENT E – DETENTION FACILITY SIZING EXHIBIT**

**Table 1**

ON-SITE DETENTION DESIGN FOR PROJECTS BETWEEN 500 SF AND 9,500 SF NEW PLUS REPLACED IMPERVIOUS SURFACE AREA

New and Replaced Impervious Surface Area (sf)	Detention Pipe Diameter (in)	Detention Pipe Length (ft)		Lowest Orifice Diameter (in) <sup>(3)</sup>		Distance from Outlet Invert to Second Orifice (ft)		Second Orifice Diameter (in)	
		B soils	C soils	B soils	C soils	B soils	C soils	B soils	C soils
500 to 1,000 sf	36"	30	22	0.5	0.5	2.2	2.0	0.5	0.8
	48"	18	11	0.5	0.5	3.3	3.2	0.9	0.8
	60"	11	7	0.5	0.5	4.2	3.4	0.5	0.6
1,001 to 2,000 sf	36"	66	43	0.5	0.5	2.2	2.3	0.9	1.4
	48"	34	23	0.5	0.5	3.2	3.3	0.9	1.2
	60"	22	14	0.5	0.5	4.3	3.6	0.9	0.9
2,001 to 3,000 sf	36"	90	66	0.5	0.5	2.2	2.4	0.9	1.9
	48"	48	36	0.5	0.5	3.1	2.8	0.9	1.5
	60"	30	20	0.5	0.5	4.2	3.7	0.9	1.1
3,001 to 4,000 sf	36"	120	78	0.5	0.5	2.4	2.2	1.4	1.6
	48"	62	42	0.5	0.5	2.8	2.9	0.8	1.3
	60"	42	26	0.5	0.5	3.8	3.9	0.9	1.3
4,001 to 5,000 sf	36"	134	91	0.5	0.5	2.8	2.2	1.7	1.5
	48"	73	49	0.5	0.5	3.6	2.9	1.6	1.5
	60"	46	31	0.5	0.5	4.6	3.5	1.6	1.3
5,001 to 6,000 sf	36"	162	109	0.5	0.5	2.7	2.2	1.8	1.6
	48"	90	59	0.5	0.5	3.5	2.9	1.7	1.5
	60"	54	37	0.5	0.5	4.6	3.6	1.6	1.4
6,001 to 7,000 sf	36"	192	128	0.5	0.5	2.7	2.2	1.9	1.8
	48"	102	68	0.5	0.5	3.7	2.9	1.9	1.6
	60"	64	43	0.5	0.5	4.6	3.6	1.8	1.5
7,001 to 8,000 sf	36"	216	146	0.5	0.5	2.8	2.2	2.0	1.9
	48"	119	79	0.5	0.5	3.8	2.9	2.2	1.7
	60"	73	49	0.5	0.5	4.5	3.6	2.0	1.6
8,001 to 8,500 sf <sup>(1)</sup>	36"	228	155	0.5	0.5	2.8	2.2	2.1	1.9
	48"	124	84	0.5	0.5	3.7	2.9	1.9	1.8
	60"	77	53	0.5	0.5	4.6	3.6	2.0	1.6
8,501 to 9,000 sf	36"	NA <sup>(1)</sup>	164	0.5	0.5	NA <sup>(1)</sup>	2.2	NA <sup>(1)</sup>	1.9
	48"	NA <sup>(1)</sup>	89	0.5	0.5	NA <sup>(1)</sup>	2.9	NA <sup>(1)</sup>	1.9
	60"	NA <sup>(1)</sup>	55	0.5	0.5	NA <sup>(1)</sup>	3.6	NA <sup>(1)</sup>	1.7
9,001 to 9,500 sf <sup>(2)</sup>	36"	NA <sup>(1)</sup>	174	0.5	0.5	NA <sup>(1)</sup>	2.2	NA <sup>(1)</sup>	2.1
	48"	NA <sup>(1)</sup>	94	0.5	0.5	NA <sup>(1)</sup>	2.9	NA <sup>(1)</sup>	2.0
	60"	NA <sup>(1)</sup>	58	0.5	0.5	NA <sup>(1)</sup>	3.7	NA <sup>(1)</sup>	1.7

**Notes:**

▪ Minimum Requirement #7 (Flow Control) is required when the 100-year flow frequency causes a 0.15 cubic feet per second increase (when modeled in WWHM with a 15-minute timestep). Breakpoints shown in this table are based on a flat slope (0-5%). The 100-year flow frequency will need to be evaluated on a site-specific basis for projects on moderate (5-15%) or steep (> 15%) slopes.

- Soil type to be determined by geotechnical analysis or soil map.
- Sizing includes a Volume Correction Factor of 120%.
- Upper bound contributing area used for sizing.

<sup>(1)</sup> On Type B soils, new plus replaced impervious surface areas exceeding 8,500 sf trigger Minimum Requirement #7 (Flow Control)

<sup>(2)</sup> On Type C soils, new plus replaced impervious surface areas exceeding 9,500 sf trigger Minimum Requirement #7 (Flow Control)

<sup>(3)</sup> Minimum orifice diameter = 0.5 inches

in = inch

ft = feet

sf = square feet

**Basis of Sizing Assumptions:**

Sized per MR#5 in the Stormwater Management Manual for Puget Sound Basin (1992 Ecology Manual)

SBUH, Type 1A, 24-hour hydrograph

2-year, 24-hour storm = 2 in; 10-year, 24-hour storm = 3 in; 100-year, 24-hour storm = 4 in

Predeveloped = second growth forest (CN = 72 for Type B soils, CN = 81 for Type C soils)

Developed = impervious (CN = 98)

0.5 foot of sediment storage in detention pipe

Overland slope = 5%

**ATTACHMENT F – ARBORIST REPORT**

## Arborist Tree Inventory Preliminary Report

**Client:** TEKIELA REVOCABLE INTER VIV

**Job Site:** 6520 82nd Ave SE Mercer Island, WA

**Parcel:** 6669200170

**Subject:** Arborist Tree Inventory Preliminary Report

**Date:** 12/27/2023

**From:** Adam C Harke, ISA Certified Arborist #PN-9506A, Tree Risk Assessor Qualified

### Assignment

I walked the site to inspect the trees and document my findings.

A summary, tree table, site map, and photographic documentation can be found below under sections 1 - 5. I have also attached the relevant current King County tree code at the end of this report.

Where applicable, I have categorized risk based on the methodologies presented in the International Society of Arboriculture's Tree Risk Assessment (Best Management Practices).

#### **My responsibilities were to provide the following:**

A tree plan that includes a tree inventory, site plan, replanting information (if necessary), tree protection measures for on-site and off-site trees (where CRZ extends on-site), and recommendations that will meet the minimum King County tree code requirements.

---

**Site Description:** Residential House with established landscape.

**Subject Trees –** Several Cherry trees, Incense Cedar, Western Hemlock, Flowering Dogwood, and Holly.

## 1. Summary

This report is preliminary as I have not reviewed any design plans or construction details for the site. Tree locations are based on a provided survey, KC Parcel Viewer data, and conditions observed during my site visit.

Retained trees will require protection measures to ensure they are not significantly impacted by construction. City Of Mercer Island tree protection measures, fencing details, and ISA recommended tree protection guidelines can be found below.

---

## 2. Tree Protection Timeline and Site Recommendations

**Prior to construction, the following measures should be taken to ensure that trees are not damaged.**

1) Project managers should review the contents of this report, including the International Society of Arboriculture's recommended tree protection measures found below under section 6 of this report. Information contained herein should be relayed to workers and subcontractors.

2) To minimize soil compaction, 6 – 10 inches of medium fine mulch should be applied within the recommended tree protection zones of this report. It should be kept at a minimum of 12 inches from the protected tree's trunk.

Once the mulch has been applied, tree protection fencing should be installed per the **King County tree and vegetation protection detail** found below.


### **Additional site recommendations.**

- Tree protection fencing and mulch should only be adjusted when access is required, such as, when scaffolding is utilized. Once the work has been completed, the fencing should return to its original placement.
- The following should be avoided within TPZ's: Stockpile construction materials or demolition debris, park vehicles or equipment, pile soil and/or mulch, contaminate soil from washing out equipment (especially concrete) and vehicle maintenance, and wound or break tree trunks or branches through contact with vehicles and heavy equipment.
- Post appropriate signage to help convey the importance of the TPZ to workers.
- **Make all necessary cuts to tree roots cleanly with sharp tools; never tear with a backhoe.** A clean cut encourages good wound closure and confines the spread of decay.
- All pruning should be conducted by an International Society of Arboriculture (ISA) certified arborist and following current ANSI A300 specifications.
- The project arborist shall supervise that the tree protection plan is being implemented.

### 3. Tree Inventory Table

Tree ID#	Parcel/ Location	Species	DBH Inches	Health Condition	Structural Condition	TRZ Radius	Overall Risk Rating	Proposed Action	Comment
395	6669200170	Incense Cedar <i>Calocedrus decurrens</i>	12",10"	GOOD	GOOD	10'	Low	Retain	
396	6669200170	Flowering Cherry <i>Prunus serrulata</i>	12"	GOOD	FAIR	12'	Low	Remove	Poorly pruned
397	6669200170	Star Magnolia <i>Magnolia stellularis</i>	6"	GOOD	GOOD	6'	Low	Retain	
398	6669200170	English Holly <i>Ilex aquifolium</i>	7"	GOOD	GOOD	7'	Low	Retain	
399	6669200170	Flowering Dogwood <i>Cornus florida</i>	5"	GOOD	GOOD	5'	Low	Retain	
400	6669200170	Western Hemlock <i>Tsuga heterophylla</i>	10"	GOOD	POOR	10'	Low	Retain	Tree Has been Topped.
003	6669200170	Flowering Cherry <i>Prunus serrulata</i>	9"	POOR	POOR	9'	Low	Remove	Damaged due to very poor pruning
241	6669200170	Black Tupelo <i>Nyssa sylvatica</i>	9"	GOOD	GOOD	9'	Low	Retain	
284	6669200170	Flowering Cherry <i>Prunus serrulata</i>	9",9"	POOR	POOR	9'	Low	Remove	Damaged due to very poor pruning
286	6669200170	Flowering Dogwood <i>Cornus florida</i>	8"	POOR	POOR	8'	Low	Remove	Damaged due to very poor pruning
687	6669200170	Japanese Maple <i>Acer palmatum</i>	10"	GOOD	GOOD	10'	Low	Retain	
688	6669200170	Flowering Cherry <i>Prunus serrulata</i>	12"	GOOD	GOOD	12'	Low	Retain	
689	6669200170	Flowering Cherry <i>Prunus serrulata</i>	12"	GOOD	GOOD	12'	Low	Retain	

#### 4. Site Map

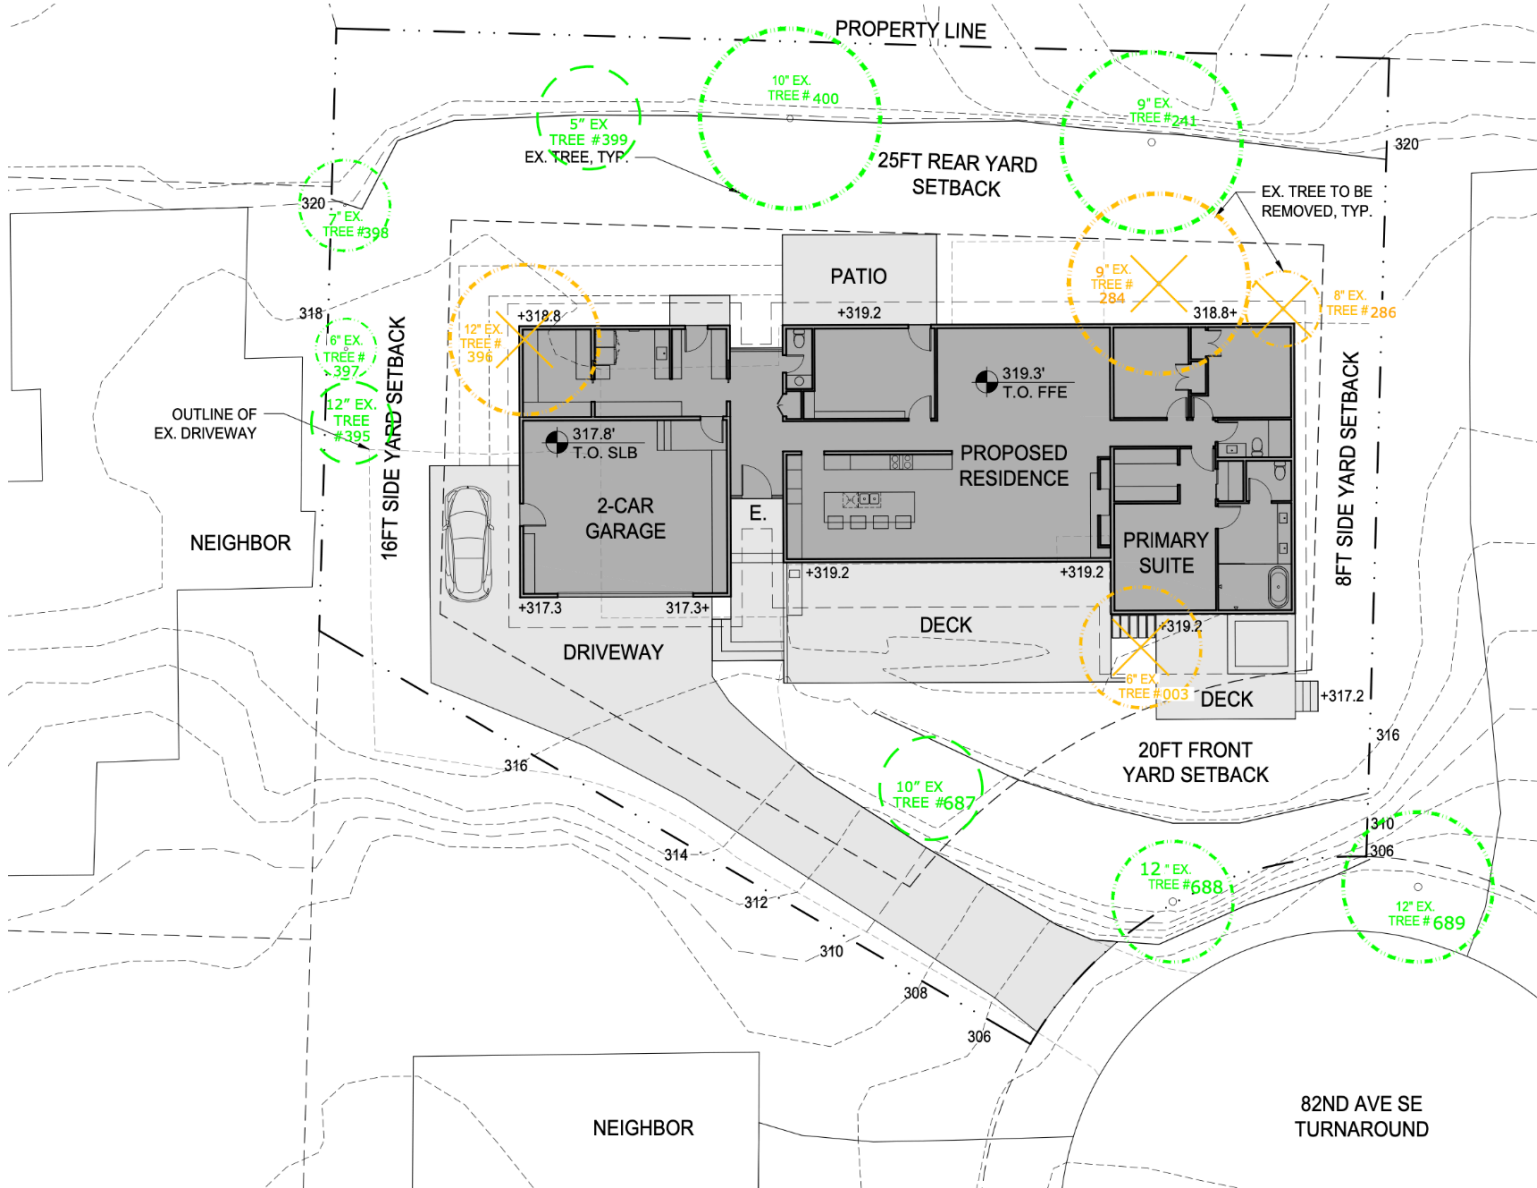

#### TEKIELA RESIDENCE

2023-11-22

SITE PLAN

1/16"=1'-0"

LOT AREA = 15,178 SF

LOT COVERAGE = 6,071 SF MAX

ROOF = 4,554 SF

DRIVE = 1,512 SF

TOTAL = 6,066 SF PROPOSED

GROSS FLOOR AREA = 6,071 SF MAX

TOTAL = 3,782 SF PROPOSED

HARDSCAPE MAX = 1,366 SF MAX

TOTAL = 842 SF PROPOSED

REQ'D LANDSCAPING = 9,107 SF MIN.

TOTAL = 10,204 SF PROPOSED



## 5. Photographic Documentation

**#395 Incense Cedar**



**#396 Flowering Cherry**



**#397 Star Magnolia**



**#398 English Holly**



**#399 Flowering Dogwood**



**#400 Western Hemlock**



**#003 Flowering Cherry**



**#241 Black Tupela**



**#284 Flowering Cherry**



**#286 Codominant Flowering Dogwood**



**#687 Japanese Maple**



**#688 Flowering Cherry**



**ADDITIONAL PHOTO UPDATE  
#689**



## 6. Details of Risk Assessment

### Level 2: Basic Assessment

A level 2 basic assessment is the standard assessment performed for tree risk. The assessment includes a detailed visual inspection of a tree and its surrounding site, and a synthesis of the information collected. The basic assessment involves walking completely around the tree – looking at the site, buttress roots, trunk, and branches. The tree is viewed from a distance, as well as close up, to consider crown shape and surroundings.

**Methodology** – When identifying potential hazard trees, I must consider a variety of factors that could contribute to failure. This can include the following: previous history of site failures, topography, site changes, prevailing wind direction and exposure, tree size and species, growth habit, overall vigor, the density and health of the foliage and crown, examination of root and root collar health, dead wood, hanging or broken branches, and evidence of disease-causing bacteria, fungi, or virus.

**Tools Utilized:** Binoculars, compass, hammer, diameter tape, clinometer.

**Timeline** – This assessment covers a five-year period and is based on conditions present at the time of the assessment.

## 7. Definitions:

**Diameter at Breast Height (DBH)** – The diameter or thickness of a tree trunk measured at 4.5 feet above average grade. For trees with multiple trunks at 4.5 feet height, only trunks 3" DBH or greater shall be included. Where a tree splits into several trunks close to ground level, the DBH for the tree is the square root of the sum of the DBH for each individual stem squared (example with 3 trunks:  $DBH = \sqrt{(stem1)^2 + (stem2)^2 + (stem3)^2}$ ). If a tree has been removed and only the stump remains that is below 4.5 feet tall, the size of the tree shall be the diameter of the top of the stump.

**Significant** – Trees with trunks greater than 6 inches in diameter, measured 4½ ft from the ground.

**Landmark Tree** – A regulated tree with a minimum 26-inch DBH.

**Grove** – A group of three or more viable regulated trees with overlapping or touching crowns that are located on a proposed development site; one of which is located in a required yard.

**Dripline** – The distance from the tree trunk that is equal to the furthest extent of the tree's crown. For trees with asymmetrical crowns, the dripline shall be measured in all four cardinal directions (North, South, East, West).

**Tree Protection Zone (TPZ)** – A defined area within and including an outer boundary, as determined by a Qualified Professional Arborist, in which certain activities are prohibited or restricted to prevent or minimize potential impacts from construction or development, applicable to individual trees or groups of tree trunks, roots and soil. TPZ is measured in feet from the face of the trunk and may be determined using Critical Root Zone, dripline, exploratory root excavations or other methodologies. The TPZ is variable depending on species, age and health of the tree, soil conditions and proposed construction. TPZ denotes the location of tree protection fencing.

## Referenced City Of Mercer Island Code:

### Tree Permits Related to Development Proposals

<https://www.mercerisland.gov/cpd/page/tree-permits-related-development-proposals>

### Trees and construction

[https://www.mercerisland.gov/sites/default/files/fileattachments/community\\_planning\\_amp\\_development/page/21988/treesandconstruction.pdf](https://www.mercerisland.gov/sites/default/files/fileattachments/community_planning_amp_development/page/21988/treesandconstruction.pdf)

### Tree Submittal Checklist

[https://www.mercerisland.gov/sites/default/files/fileattachments/community\\_planning\\_amp\\_development/page/21988/treessubmittalchecklist.pdf](https://www.mercerisland.gov/sites/default/files/fileattachments/community_planning_amp_development/page/21988/treessubmittalchecklist.pdf)

---

## 8. ISA Recommended Tree Protection Information

The Pacific Northwest Chapter of the ISA Recommends the following for protecting trees from damage during construction.

<https://pnwisa.org/tree-care/damage/protecting-trees-from-damage/>

### Critical Root Zone Protection

A critical step in retaining healthy trees is the protection of tree roots from disturbance. Each tree has a critical root zone (CRZ) that varies by species and site conditions. The International Society of Arboriculture defines CRZ as an area equal to a 1-foot radius from the base of the tree's trunk for each 1 inch of the tree's diameter at 4.5 feet above grade (referred to as diameter at breast height).

Another common rule of thumb is to use a tree's drip line to estimate the CRZ (see figure). Evaluate both of these and choose whichever provides the larger CRZ.

Under certain circumstances, disturbing or cutting roots in a CRZ may be unavoidable. In such cases, the work should be done only under the on-site supervision of an [ISA Certified Arborist](#).

Cutting or disturbing a large percentage of a tree's roots increases the likelihood of the tree's failure or death. Never cut tree roots that are more than four inches wide; roots that large are usually structural. Cutting them can destroy the stability of the tree, causing it to fall over!

If you must cut tree roots, do so cleanly with sharp tools. Never tear with a backhoe or other dull instrument. A clean cut encourages good wound closure and confines the spread of decay. If damage is severe, consider removing the tree because its stability may have been compromised.

---

## Activities to Avoid in the Critical Root Zone

The CRZ that should be protected from negative interactions. Avoid the following activities:

- Stockpiling construction materials or demolition debris
- Parking vehicles or equipment
- Piling soil and/or mulch
- Trenching for utilities installation or repair, or for irrigation system installation
- Changing soil grade by cutting or filling
- Damaging roots by grading, tearing, or grubbing
- Compacting soil with equipment, vehicles, material storage, and/or foot traffic
- Contaminating soil from washing out equipment (especially concrete) and vehicle maintenance
- Installing impervious parking lots, driveways, and walkways
- Attaching anything to trees using nails, screws, or spikes
- Wounding or breaking tree trunks or branches through contact with vehicles and heavy equipment
- Wounding trunks with string weed trimmers and lawn mowers
- Causing injury by fire or excessive heat

---

## During Construction

Monitor compliance with tree protection requirements and the impacts of construction activities on tree health regularly during construction. If there are incursions into the root zone, ensure roots have been severed cleanly, enforce penalties, and reestablish the protection zone. Confer with your contractors to make sure that construction offices, vehicular parking, worker break sites, concrete washout areas or other pollutants, and material storage will remain outside of protected areas. Diligence in maintaining barriers and in enforcing your protection plan will pay great dividends at the end of the project when the tree is still healthy.

Following the guidelines laid out above will serve in most situations, but occasionally construction plans will require impingement on the CRZ.

---

## Trenching

Trenching is a standard way to install utilities. **It is best to entirely avoid trenching through the CRZ** (see figure); such practice could severely destabilize a tree, as well as adversely affect its health through loss of roots. Workers performing such operations should understand that 85% of the mass of a tree's root system is located within the CRZ and that most of a tree's roots are within the top 18 inches of soil. Alter routes of underground infrastructure or use alternate methods such as pipe boring. Tunneling at least 18 inches beneath the root zone will prevent loss of critical root mass if underground utilities must unavoidably be placed within the CRZ.

A decision must be made as to where best to locate utility trenches. Planners and designers must be made aware that trenches may not cross a CRZ and design alternate alignments accordingly; such realignments are not the responsibility of the construction crew.

Best practices for trenching include the following:

- Protect the trunks of high-value trees from scraping and gouging to a height of at least eight feet.
- Keep equipment and excavated backfill on the side furthest from the tree, not against the trunk.
- Place excavated backfill on a plastic or canvas tarp outside the CRZ.
- Prune away jagged roots back to the trench wall closest to the tree. Use a handheld pruner or pruning saw to make sharp, clean cuts.
- Replace the backfill on the same day if at all possible. Cover exposed roots with wet burlap to prevent them from drying out; in hot dry conditions, small roots may be injured in as little as 30 minutes.
- Do not allow chemicals, trash, or other foreign debris to become mixed with the backfill.
- If earthwork specifications allow it, firm the backfill to the same compaction as the surrounding soil and no more.
- Water the backfill to prevent excessive root drying.

---

### **Grade or Ground Level Changes**

Grade changes should be avoided in order to prevent serious damage or death to a tree. Fill that is added over existing soils can smother and kill roots, or invite disease if piled around the trunk. Even temporary fills such as stockpiling mulch or soil in the CRZ of a tree for as little as several days during the construction process can have severe, long-term negative effects, though symptoms may not appear for several years.

The extent of injury from adding soil around a tree varies with the kind, age, and condition of the tree; the depth and type of fill; drainage; and several other factors. Maple, oak, and evergreens are most susceptible, while elm, ash, willow, sycamore, and locust are least affected.

Little can be done to save trees that have been suffering from soil added over an extended period of time. It is prudent to consider possible damage that may occur to a tree and take alternative action before the fill is made; prevention is less expensive and more effective than attempting to correct the situation after damage has been done.

Best practices for fill operations include the following:

- Never place any fill or organic materials directly against the tree.
- Never compact the soil within the CRZ.
- If using no more than two to four inches of fill around existing trees, significant damage may be avoided if the fill has a coarser texture than the existing soil.

Less damage to a tree's roots is likely with a lowered grade than when it is raised, unless exposing or removing a great deal of the root mass. A general rule-of-thumb used by landscape architects is to remove no more than six inches of soil from the existing grade in the CRZ; however, this is dependent on the soils in which the tree is growing. A tree's roots may all exist in the top foot of a shallow soil; removing the top six inches would have tremendous negative impact in that case.

Best practices for removing soil include the following:

- Consider removal and replacement if the tree is young, in poor condition, an undesirable species, or very susceptible to insects and disease.
- Plan grade changes well in advance of construction using the appropriate method to prevent injury to desirable trees.
- Use retaining walls or terraces to avoid excessive soil loss in the area of greatest root growth.
- Spread mulch over the exposed root area when possible, to help prevent soil erosion, reduce moisture loss, and keep soil temperatures lower.
- Provide supplementary water when rainfall is less than one inch per week.
- Prune roots to prepare the tree for root loss due to grade lowering. Root pruning is best left to an ISA Certified Arborist, who can take into account the variables necessary to reduce the stress of the pruning to the tree.

## 9. Certificate of Performance

I, Adam C Harke, certify that:

- I have personally inspected the trees and the property referred to in this report and have stated my findings accurately.
- I have no current or prospective interest in the vegetation or the property that is the subject of this report and have no personal interest or bias with respect to the parties involved.
- The analysis, opinion, and conclusions stated herein are my own and are based on current industry standards, scientific procedures, and facts.
- My analysis, opinion, and conclusions were developed, and this report has been prepared according to commonly accepted arboriculture practices.
- No one provided significant professional assistance to me, except as indicated within the report.
- My compensation is not contingent upon the reporting of predetermined conclusions that favors the cause of the client or any other party nor upon the results of the assessment, the attainment of stipulated results, or the occurrence of any subsequent events.

I further certify that I am a member in good standing of the International Society of Arboriculture (ISA) and an ISA Certified Arborist (#PN-9506A) and Tree Risk Assessment Qualified.

---

If you have any questions about this report, please contact me at 360-739-5236 or [artisttouch@mac.com](mailto:artisttouch@mac.com).

Adam C Harke



---

### References:

Dirr, Michael A. *Manual of Woody Landscape Plants Their Identification, Ornamental Characteristics, Culture, Propagation, and Use*. Stripes Publishing L.L.C., 2009

Smiley, E. Thomas, Nelda Matheny, and Sharon Lilly. *Tree Risk Assessment (Best Management Practices, Second Edition)*. Champaign: International Society of Arboriculture, 2017.

Dunster, Julian A., E. Thomas Smiley, Nelda Matheny, and Sharon Lilly. *Tree Risk Assessment Manual*. Champaign, Illinois: International Society of Arboriculture, 2013.

Shigo, Alex L. *A New Tree Biology: Facts, Photos, and Philosophies on Trees and Their Problems and Proper Care*. Shigo and Trees, Associates, 1986.

## 10. Credentials & Experience

Certified Arborist and Qualified Tree Risk Assessor, through the International Society of Arboriculture #PN-7375A.

To earn an ISA Certified Arborist® credential, you must be trained and knowledgeable in all aspects of arboriculture. ISA Certified Arborist® have met all requirements to be eligible for the exam, which includes three or more years of full-time, eligible, practical work experience in arboriculture and/or a degree in the field of arboriculture, horticulture, landscape architecture, or forestry from a regionally accredited educational institute. This certification covers a large number of topics giving the candidates flexibility in the arboricultural profession. A code of ethics for ISA Certified Arborists® strengthens the credibility and reliability of the work force. This certification is accredited by the American National Standards Institute, meeting, and exceeding ISO 17024.

## 11. Assumptions & Limiting Conditions

- a) A field examination of the site was made on **12/20/2023**. My observations and conclusions are as of that date.
- b) Care has been taken to obtain all information from reliable sources. All data has been verified insofar as possible; however, the consultant/arborist can neither guarantee nor be responsible for accuracy of information provided by others.
- c) Unless stated otherwise: 1) information contained in this report covers only those trees that were examined and reflects the conditions of those trees at the time of inspection; and 2) the inspection is limited to visual examination of the subject trees without dissection, excavation, probing, or coring. There is no warranty or guarantee, expressed or implied that problems or deficiencies of the subject tree may not arise in the future.
- d) All trees possess the risk of failure. Trees can fail at any time, with or without obvious defects, and with or without applied stress. A complete evaluation of the potential for this (a) tree to fail requires excavation and examination of the base of the subject tree. Permission of the current property owner must be obtained before this work can be undertaken and the hazard evaluation completed.
- e) Other trees with similar defects are standing in the neighborhood and have been so for some time. Trees are living biological organisms, and I cannot predict nor guarantee their stability or failure.
- f) Sketches, drawings, and photographs in this report, being intended as visual aids, are not necessarily to scale and should not be construed as engineering or architectural report of surveys unless expressed otherwise. The reproduction of any information generated by architects, engineers, or other consultants on any sketches, drawings, or photographs is for the express purpose of coordination and ease of reference only. Inclusion of said information on any drawings or other documents does not constitute a representation by Tree Frog LLC as to the sufficiency or accuracy of said information.
- g) The consultant/appraiser shall not be required to give testimony or attend court because of this report unless subsequent contractual arrangements are made.
- h) Loss or alteration of any part of this report invalidates the entire report.
- i) Unless required by law otherwise, possession of this report or a copy thereof does not imply right of publication or use for any purpose by any other than the person to whom it is addressed, without the prior expressed written or verbal consent of the consultant/appraiser.

## ATTACHMENT G – WWHM REPORT

**WWHM2012**  
**PROJECT REPORT**

# General Model Information

Project Name: WWHM  
Site Name: 6520 82nd Ave SE  
Site Address: 6520 82nd Ave SE  
City: Mercer Island  
Report Date: 2/1/2024  
Gage: Seatac  
Data Start: 1948/10/01  
Data End: 2009/09/30  
Timestep: 15 Minute  
Precip Scale: 0.000 (adjusted)  
Version Date: 2021/08/18  
Version: 4.2.18

## POC Thresholds

---

Low Flow Threshold for POC1:	50 Percent of the 2 Year
High Flow Threshold for POC1:	50 Year

---

# Landuse Basin Data

## Predeveloped Land Use

### Basin 1

Bypass:	No
GroundWater:	No
Pervious Land Use A B, Forest, Mod	acre 0.348
Pervious Total	0.348
Impervious Land Use	acre
Impervious Total	0
Basin Total	0.348

Element Flows To:		
Surface	Interflow	Groundwater

## Mitigated Land Use

### Roof

Bypass:	No
GroundWater:	No
Pervious Land Use	acre
Pervious Total	0
Impervious Land Use	acre
ROOF TOPS FLAT	0.104
Impervious Total	0.104
Basin Total	0.104

Element Flows To:		
Surface	Interflow	Groundwater
Tank 1	Tank 1	

## Driveway and walkway to Detention

Bypass:	No
GroundWater:	No
Pervious Land Use	acre
Pervious Total	0
Impervious Land Use	acre
DRIVEWAYS MOD	0.04
Impervious Total	0.04
Basin Total	0.04

Element Flows To:		
Surface	Interflow	Groundwater
Tank 1	Tank 1	

## Driveway unmitigated

Bypass:	Yes
GroundWater:	No
Pervious Land Use	acre
Pervious Total	0
Impervious Land Use	acre
DRIVEWAYS MOD	0.022
Impervious Total	0.022
Basin Total	0.022

Element Flows To:		
Surface	Interflow	Groundwater

landscaping

Bypass:	Yes
GroundWater:	No
Pervious Land Use A B, Lawn, Mod	acre 0.182
Pervious Total	0.182
Impervious Land Use	acre
Impervious Total	0
Basin Total	0.182

Element Flows To:		
Surface	Interflow	Groundwater

*Routing Elements*  
*Predeveloped Routing*

## Mitigated Routing

### Tank 1

Dimensions  
 Depth: 5 ft.  
 Tank Type: Circular  
 Diameter: 5 ft.  
 Length: 73 ft.  
 Discharge Structure  
 Riser Height: 5.35 ft.  
 Riser Diameter: 6 in.  
 Orifice 1 Diameter: 0.55 in. Elevation:-1.5 ft.  
 Orifice 2 Diameter: 2 in. Elevation:5 ft.  
 Element Flows To:  
 Outlet 1                      Outlet 2



Tank Hydraulic Table

Stage(feet)	Area(ac.)	Volume(ac-ft.)	Discharge(cfs)	Infilt(cfs)
309.40	0.000000	0.000000	0.010	0.000
309.46	0.001757	0.000065	0.010	0.000
309.51	0.002470	0.000184	0.010	0.000
309.57	0.003008	0.000337	0.010	0.000
309.62	0.003454	0.000516	0.010	0.000
309.68	0.003839	0.000719	0.010	0.000
309.73	0.004180	0.000942	0.011	0.000
309.79	0.004488	0.001183	0.011	0.000
309.84	0.004769	0.001440	0.011	0.000
309.90	0.005028	0.001713	0.011	0.000
309.96	0.005267	0.001999	0.011	0.000
310.01	0.005489	0.002297	0.011	0.000
310.07	0.005697	0.002608	0.012	0.000
310.12	0.005891	0.002930	0.012	0.000
310.18	0.006074	0.003263	0.012	0.000
310.23	0.006246	0.003605	0.012	0.000
310.29	0.006407	0.003956	0.012	0.000
310.34	0.006560	0.004317	0.012	0.000
310.40	0.006703	0.004685	0.013	0.000
310.46	0.006839	0.005061	0.013	0.000
310.51	0.006967	0.005445	0.013	0.000
310.57	0.007088	0.005835	0.013	0.000
310.62	0.007202	0.006232	0.013	0.000
310.68	0.007310	0.006635	0.013	0.000
310.73	0.007411	0.007044	0.013	0.000
310.79	0.007506	0.007459	0.014	0.000
310.84	0.007596	0.007878	0.014	0.000
310.90	0.007680	0.008303	0.014	0.000
310.96	0.007758	0.008731	0.014	0.000
311.01	0.007832	0.009164	0.014	0.000
311.07	0.007900	0.009601	0.014	0.000
311.12	0.007963	0.010042	0.014	0.000
311.18	0.008022	0.010486	0.014	0.000
311.23	0.008076	0.010933	0.015	0.000
311.29	0.008125	0.011383	0.015	0.000
311.34	0.008170	0.011836	0.015	0.000
311.40	0.008210	0.012291	0.015	0.000

311.46	0.008246	0.012748	0.015	0.000
311.51	0.008277	0.013207	0.015	0.000
311.57	0.008304	0.013668	0.015	0.000
311.62	0.008327	0.014130	0.015	0.000
311.68	0.008346	0.014593	0.016	0.000
311.73	0.008361	0.015057	0.016	0.000
311.79	0.008371	0.015522	0.016	0.000
311.84	0.008377	0.015987	0.016	0.000
311.90	0.008379	0.016453	0.016	0.000
311.96	0.008377	0.016918	0.016	0.000
312.01	0.008371	0.017383	0.016	0.000
312.07	0.008361	0.017848	0.016	0.000
312.12	0.008346	0.018312	0.016	0.000
312.18	0.008327	0.018775	0.017	0.000
312.23	0.008304	0.019237	0.017	0.000
312.29	0.008277	0.019698	0.017	0.000
312.34	0.008246	0.020157	0.017	0.000
312.40	0.008210	0.020614	0.017	0.000
312.46	0.008170	0.021069	0.017	0.000
312.51	0.008125	0.021522	0.017	0.000
312.57	0.008076	0.021972	0.017	0.000
312.62	0.008022	0.022419	0.017	0.000
312.68	0.007963	0.022863	0.017	0.000
312.73	0.007900	0.023304	0.018	0.000
312.79	0.007832	0.023741	0.018	0.000
312.84	0.007758	0.024174	0.018	0.000
312.90	0.007680	0.024603	0.018	0.000
312.96	0.007596	0.025027	0.018	0.000
313.01	0.007506	0.025447	0.018	0.000
313.07	0.007411	0.025861	0.018	0.000
313.12	0.007310	0.026270	0.018	0.000
313.18	0.007202	0.026673	0.018	0.000
313.23	0.007088	0.027070	0.019	0.000
313.29	0.006967	0.027460	0.019	0.000
313.34	0.006839	0.027844	0.019	0.000
313.40	0.006703	0.028220	0.019	0.000
313.46	0.006560	0.028589	0.019	0.000
313.51	0.006407	0.028949	0.019	0.000
313.57	0.006246	0.029300	0.019	0.000
313.62	0.006074	0.029643	0.019	0.000
313.68	0.005891	0.029975	0.019	0.000
313.73	0.005697	0.030297	0.019	0.000
313.79	0.005489	0.030608	0.019	0.000
313.84	0.005267	0.030907	0.020	0.000
313.90	0.005028	0.031193	0.020	0.000
313.96	0.004769	0.031465	0.020	0.000
314.01	0.004488	0.031722	0.020	0.000
314.07	0.004180	0.031963	0.020	0.000
314.12	0.003839	0.032186	0.020	0.000
314.18	0.003454	0.032389	0.020	0.000
314.23	0.003008	0.032569	0.020	0.000
314.29	0.002470	0.032721	0.020	0.000
314.34	0.001757	0.032840	0.020	0.000
314.40	0.000000	0.032905	0.020	0.000
314.46	0.000000	0.000000	0.046	0.000

# Analysis Results

## POC 1

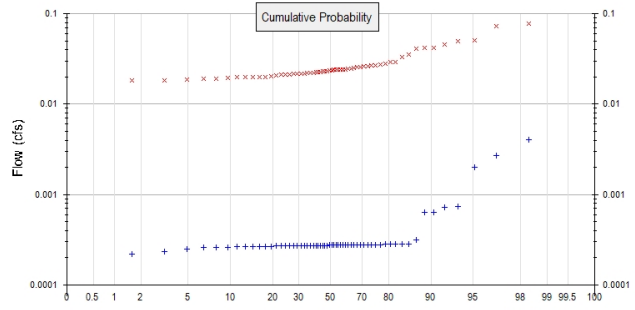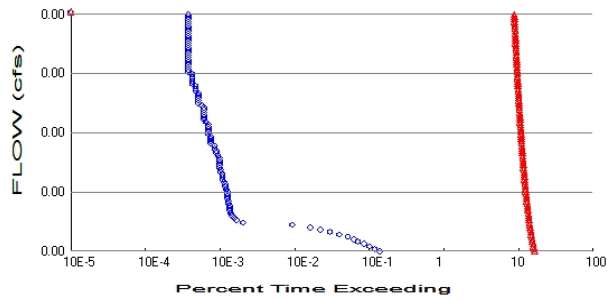

+ Predeveloped    x Mitigated

### Predeveloped Landuse Totals for POC #1

Total Pervious Area: 0.348  
Total Impervious Area: 0

### Mitigated Landuse Totals for POC #1

Total Pervious Area: 0.182  
Total Impervious Area: 0.166

Flow Frequency Method: Log Pearson Type III 17B

### Flow Frequency Return Periods for Predeveloped. POC #1

Return Period	Flow(cfs)
2 year	0.000302
5 year	0.000498
10 year	0.000673
25 year	0.000955
50 year	0.001218
100 year	0.001534

### Flow Frequency Return Periods for Mitigated. POC #1

Return Period	Flow(cfs)
2 year	0.024521
5 year	0.032693
10 year	0.038966
25 year	0.047935
50 year	0.055417
100 year	0.063628

## Annual Peaks

### Annual Peaks for Predeveloped and Mitigated. POC #1

Year	Predeveloped	Mitigated
1949	0.000	0.026
1950	0.001	0.042
1951	0.001	0.028
1952	0.000	0.018
1953	0.000	0.020
1954	0.000	0.024
1955	0.000	0.022
1956	0.000	0.025
1957	0.000	0.023
1958	0.000	0.019

1959	0.000	0.020
1960	0.000	0.027
1961	0.000	0.022
1962	0.000	0.018
1963	0.000	0.021
1964	0.000	0.024
1965	0.000	0.024
1966	0.000	0.019
1967	0.000	0.042
1968	0.000	0.027
1969	0.000	0.021
1970	0.000	0.021
1971	0.000	0.023
1972	0.002	0.036
1973	0.000	0.018
1974	0.000	0.022
1975	0.000	0.024
1976	0.000	0.023
1977	0.000	0.020
1978	0.000	0.023
1979	0.000	0.026
1980	0.000	0.026
1981	0.000	0.022
1982	0.000	0.029
1983	0.000	0.024
1984	0.000	0.019
1985	0.000	0.022
1986	0.000	0.024
1987	0.000	0.024
1988	0.000	0.020
1989	0.000	0.024
1990	0.000	0.072
1991	0.001	0.041
1992	0.000	0.020
1993	0.000	0.020
1994	0.000	0.019
1995	0.000	0.022
1996	0.003	0.046
1997	0.000	0.027
1998	0.000	0.022
1999	0.001	0.050
2000	0.000	0.021
2001	0.000	0.023
2002	0.000	0.026
2003	0.000	0.024
2004	0.000	0.033
2005	0.000	0.022
2006	0.000	0.025
2007	0.004	0.077
2008	0.000	0.051
2009	0.000	0.030

### Ranked Annual Peaks

Ranked Annual Peaks for Predeveloped and Mitigated. POC #1

Rank	Predeveloped	Mitigated
1	0.0040	0.0771
2	0.0027	0.0722
3	0.0020	0.0512

4	0.0007	0.0497
5	0.0007	0.0455
6	0.0006	0.0422
7	0.0006	0.0415
8	0.0003	0.0413
9	0.0003	0.0357
10	0.0003	0.0334
11	0.0003	0.0295
12	0.0003	0.0291
13	0.0003	0.0279
14	0.0003	0.0273
15	0.0003	0.0267
16	0.0003	0.0266
17	0.0003	0.0263
18	0.0003	0.0261
19	0.0003	0.0259
20	0.0003	0.0256
21	0.0003	0.0251
22	0.0003	0.0247
23	0.0003	0.0244
24	0.0003	0.0242
25	0.0003	0.0242
26	0.0003	0.0242
27	0.0003	0.0242
28	0.0003	0.0242
29	0.0003	0.0240
30	0.0003	0.0238
31	0.0003	0.0237
32	0.0003	0.0232
33	0.0003	0.0231
34	0.0003	0.0231
35	0.0003	0.0228
36	0.0003	0.0227
37	0.0003	0.0225
38	0.0003	0.0223
39	0.0003	0.0222
40	0.0003	0.0222
41	0.0003	0.0218
42	0.0003	0.0217
43	0.0003	0.0217
44	0.0003	0.0216
45	0.0003	0.0214
46	0.0003	0.0214
47	0.0003	0.0212
48	0.0003	0.0209
49	0.0003	0.0203
50	0.0003	0.0199
51	0.0003	0.0199
52	0.0003	0.0199
53	0.0003	0.0198
54	0.0003	0.0198
55	0.0003	0.0194
56	0.0003	0.0192
57	0.0003	0.0190
58	0.0002	0.0188
59	0.0002	0.0185
60	0.0002	0.0183
61	0.0002	0.0182



## Duration Flows

Flow(cfs)	Predev	Mit	Percentage	Pass/Fail
0.0002	2911	350349	12035	Fail
0.0002	2513	344787	13720	Fail
0.0002	2136	339226	15881	Fail
0.0002	1802	334093	18540	Fail
0.0002	1504	329174	21886	Fail
0.0002	1316	325110	24704	Fail
0.0002	1095	320618	29280	Fail
0.0002	854	316554	37067	Fail
0.0002	629	312704	49714	Fail
0.0002	474	309068	65204	Fail
0.0003	343	305860	89172	Fail
0.0003	197	302438	153521	Fail
0.0003	43	299229	695881	Fail
0.0003	35	296021	845774	Fail
0.0003	33	293454	889254	Fail
0.0003	31	290674	937658	Fail
0.0003	30	287893	959643	Fail
0.0003	29	285327	983886	Fail
0.0003	29	282760	975034	Fail
0.0004	29	280407	966920	Fail
0.0004	28	278054	993050	Fail
0.0004	28	275702	984650	Fail
0.0004	27	273349	1012403	Fail
0.0004	27	271424	1005274	Fail
0.0004	27	269499	998144	Fail
0.0004	27	267360	990222	Fail
0.0004	26	265221	1020080	Fail
0.0004	25	263296	1053184	Fail
0.0005	25	261585	1046340	Fail
0.0005	24	259874	1082808	Fail
0.0005	23	257949	1121517	Fail
0.0005	23	256238	1114078	Fail
0.0005	23	254527	1106639	Fail
0.0005	22	252816	1149163	Fail
0.0005	22	251318	1142354	Fail
0.0005	21	249607	1188604	Fail
0.0005	21	248110	1181476	Fail
0.0005	21	246827	1175366	Fail
0.0006	21	245116	1167219	Fail
0.0006	21	243618	1160085	Fail
0.0006	20	242335	1211675	Fail
0.0006	19	241052	1268694	Fail
0.0006	19	239555	1260815	Fail
0.0006	18	238271	1323727	Fail
0.0006	18	236988	1316600	Fail
0.0006	16	235491	1471818	Fail
0.0006	16	234421	1465131	Fail
0.0007	16	233138	1457112	Fail
0.0007	16	231855	1449093	Fail
0.0007	15	230785	1538566	Fail
0.0007	15	229716	1531440	Fail
0.0007	15	228432	1522880	Fail
0.0007	15	227363	1515753	Fail
0.0007	15	226080	1507200	Fail

0.0007	14	225010	1607214	Fail
0.0007	13	223941	1722623	Fail
0.0008	13	222871	1714392	Fail
0.0008	13	221802	1706169	Fail
0.0008	13	220732	1697938	Fail
0.0008	13	219663	1689715	Fail
0.0008	13	218807	1683130	Fail
0.0008	12	217738	1814483	Fail
0.0008	11	216669	1969718	Fail
0.0008	11	215599	1959990	Fail
0.0008	11	214744	1952218	Fail
0.0009	11	213802	1943654	Fail
0.0009	11	212840	1934909	Fail
0.0009	10	211920	2119200	Fail
0.0009	10	211129	2111290	Fail
0.0009	10	210209	2102090	Fail
0.0009	9	209247	2324966	Fail
0.0009	9	208391	2315455	Fail
0.0009	9	207536	2305955	Fail
0.0009	9	206701	2296677	Fail
0.0009	9	205803	2286700	Fail
0.0010	8	204947	2561837	Fail
0.0010	8	204113	2551412	Fail
0.0010	8	203386	2542325	Fail
0.0010	8	202531	2531637	Fail
0.0010	8	201739	2521737	Fail
0.0010	8	200926	2511575	Fail
0.0010	8	200135	2501687	Fail
0.0010	8	199408	2492600	Fail
0.0010	8	198638	2482975	Fail
0.0011	8	197846	2473075	Fail
0.0011	8	197034	2462925	Fail
0.0011	8	196371	2454637	Fail
0.0011	8	195601	2445012	Fail
0.0011	8	194831	2435387	Fail
0.0011	8	194082	2426025	Fail
0.0011	8	193376	2417200	Fail
0.0011	8	192713	2408912	Fail
0.0011	8	191986	2399825	Fail
0.0012	8	191259	2390737	Fail
0.0012	8	190553	2381912	Fail
0.0012	8	189911	2373887	Fail
0.0012	8	189248	2365600	Fail
0.0012	8	188585	2357312	Fail
0.0012	8	187922	2349025	Fail
0.0012	8	187280	2341000	Fail

The development has an increase in flow durations from 1/2 Predeveloped 2 year flow to the 2 year flow or more than a 10% increase from the 2 year to the 50 year flow.

The development has an increase in flow durations for more than 50% of the flows for the range of the duration analysis.

## Water Quality

Water Quality BMP Flow and Volume for POC #1

On-line facility volume: 0 acre-feet

On-line facility target flow: 0 cfs.

Adjusted for 15 min: 0 cfs.

Off-line facility target flow: 0 cfs.

Adjusted for 15 min: 0 cfs.

# LID Report

LID Technique	Used for Treatment ?	Total Volume Needs Treatment (ac-ft)	Volume Through Facility (ac-ft)	Infiltration Volume (ac-ft)	Cumulative Volume Infiltration Credit	Percent Volume Infiltrated	Water Quality	Percent Water Quality Treated	Comment
Tank 1 POC	<input type="checkbox"/>	20.68			<input type="checkbox"/>	0.00			
Total Volume Infiltrated		20.68	0.00	0.00		0.00	0.00	0%	No Treat. Credit
Compliance with LID Standard 8% of 2-yr to 50% of 2-yr									Duration Analysis Result = Failed

## *Model Default Modifications*

Total of 0 changes have been made.

### *PERLND Changes*

No PERLND changes have been made.

### *IMPLND Changes*

No IMPLND changes have been made.

*Appendix*  
*Predeveloped Schematic*



Basin 1  
0.35ac

Mitigated Schematic



# Predeveloped UCI File

RUN

GLOBAL

```
WVHM4 model simulation
START      1948 10 01      END      2009 09 30
RUN INTERP OUTPUT LEVEL  3      0
RESUME     0 RUN      1
UNIT SYSTEM      1
END GLOBAL
```

FILES

```
<File> <Un#> <-----File Name----->***
<-ID->                                     ***
WDM      26      WVHM.wdm
MESSU    25      PreWVHM.MES
          27      PreWVHM.L61
          28      PreWVHM.L62
          30      POCWVHM1.dat
```

END FILES

OPN SEQUENCE

```
INGRP              INDELT 00:15
  PERLND           2
  COPY             501
  DISPLY           1
```

END INGRP

END OPN SEQUENCE

DISPLY

DISPLY-INFO1

```
# - #<-----Title----->***TRAN PIVL DIG1 FIL1  PYR DIG2 FIL2 YRND
1      Basin 1              MAX              1      2      30      9
```

END DISPLY-INFO1

END DISPLY

COPY

TIMESERIES

```
# - # NPT NMN ***
1      1      1
501    1      1
```

END TIMESERIES

END COPY

GENER

OPCODE

```
#      # OPCD ***
```

END OPCODE

PARM

```
#      #      K ***
```

END PARM

END GENER

PERLND

GEN-INFO

```
<PLS ><-----Name----->NBLKS  Unit-systems  Printer ***
# - #      User  t-series  Engl Metr ***
              in  out      ***
```

```
2      A/B, Forest, Mod      1      1      1      1      27      0
```

END GEN-INFO

\*\*\* Section PWATER\*\*\*

ACTIVITY

```
<PLS > ***** Active Sections *****
# - # ATMP SNOW PWAT  SED  PST  PWG  PQAL MSTL PEST NITR PHOS TRAC ***
2      0      0      1      0      0      0      0      0      0      0      0      0
```

END ACTIVITY

PRINT-INFO

```
<PLS > ***** Print-flags ***** PIVL  PYR
# - # ATMP SNOW PWAT  SED  PST  PWG  PQAL MSTL PEST NITR PHOS TRAC *****
2      0      0      4      0      0      0      0      0      0      0      0      0      1      9
```

END PRINT-INFO

```

PWAT-PARM1
<PLS > PWATER variable monthly parameter value flags ***
# - # CSNO RTOP UZFG VCS VUZ VNN VIFW VIRC VLE INFC HWT ***
2 0 0 0 0 0 0 0 0 0 0 0
END PWAT-PARM1

PWAT-PARM2
<PLS > PWATER input info: Part 2 ***
# - # ***FOREST LZSN INFILT LSUR SLSUR KVARY AGWRC
2 0 5 2 400 0.1 0.3 0.996
END PWAT-PARM2

PWAT-PARM3
<PLS > PWATER input info: Part 3 ***
# - # ***PETMAX PETMIN INFEXP INFILD DEEPFR BASETP AGWETP
2 0 0 2 2 0 0 0
END PWAT-PARM3

PWAT-PARM4
<PLS > PWATER input info: Part 4 ***
# - # CEPSC UZSN NSUR INTFW IRC LZETP ***
2 0.2 0.5 0.35 0 0.7 0.7
END PWAT-PARM4

PWAT-STATE1
<PLS > *** Initial conditions at start of simulation
ran from 1990 to end of 1992 (pat 1-11-95) RUN 21 ***
# - # *** CEPS SURS UZS IFWS LZS AGWS GWVS
2 0 0 0 0 3 1 0
END PWAT-STATE1

END PERLND

IMPLND
GEN-INFO
<PLS ><-----Name-----> Unit-systems Printer ***
# - # User t-series Engr Metr ***
in out ***
END GEN-INFO
*** Section IWATER***

ACTIVITY
<PLS > ***** Active Sections *****
# - # ATMP SNOW IWAT SLD IWG IQAL ***
END ACTIVITY

PRINT-INFO
<ILS > ***** Print-flags ***** PIVL PYR
# - # ATMP SNOW IWAT SLD IWG IQAL *****
END PRINT-INFO

IWAT-PARM1
<PLS > IWATER variable monthly parameter value flags ***
# - # CSNO RTOP VRS VNN RTLI ***
END IWAT-PARM1

IWAT-PARM2
<PLS > IWATER input info: Part 2 ***
# - # *** LSUR SLSUR NSUR RETSC
END IWAT-PARM2

IWAT-PARM3
<PLS > IWATER input info: Part 3 ***
# - # ***PETMAX PETMIN
END IWAT-PARM3

IWAT-STATE1
<PLS > *** Initial conditions at start of simulation
# - # *** RETS SURS
END IWAT-STATE1

```

END IMPLND

SCHEMATIC

<-Source->	<Name> #	<--Area-->	<-factor-->	<-Target->	<Name> #	MBLK	Tbl#	***
Basin	1							***
PERLND	2		0.348	COPY	501		12	
PERLND	2		0.348	COPY	501		13	

\*\*\*\*\*Routing\*\*\*\*\*  
END SCHEMATIC

NETWORK

<-Volume->	<-Grp>	<-Member->	<--Mult-->	Tran	<-Target vols>	<-Grp>	<-Member->	***	
<Name> #		<Name> #	#	<-factor-->strg	<Name> #	#	<Name> #	***	
COPY	501	OUTPUT	MEAN	1 1	48.4	DISPLY	1	INPUT	TIMSER 1

<-Volume->	<-Grp>	<-Member->	<--Mult-->	Tran	<-Target vols>	<-Grp>	<-Member->	***
<Name> #		<Name> #	#	<-factor-->strg	<Name> #	#	<Name> #	***

END NETWORK

RCHRES

GEN-INFO

RCHRES	Name	Nexits	Unit	Systems	Printer	***
# - #	<----->	<---->	User	T-series	Engl Metr	LKFG
				in out		***

END GEN-INFO

\*\*\* Section RCHRES\*\*\*

ACTIVITY

<PLS > \*\*\*\*\* Active Sections \*\*\*\*\*

# - #	HYFG	ADFG	CNFG	HTFG	SDFG	GQFG	OXFG	NUFG	PKFG	PHFG	***

END ACTIVITY

PRINT-INFO

<PLS > \*\*\*\*\* Print-flags \*\*\*\*\* PIVL PYR

# - #	HYDR	ADCA	CONS	HEAT	SED	GQL	OXRX	NUTR	PLNK	PHCB	PIVL	PYR	*****

END PRINT-INFO

HYDR-PARM1

RCHRES	Flags for each HYDR Section	***	ODGTFG for each	FUNCT for each	***
# - #	VC A1 A2 A3	ODFVFG for each	***	ODGTFG for each	FUNCT for each
	FG FG FG FG	possible exit	***	possible exit	possible exit
	* * * *	* * * * *		* * * * *	***

END HYDR-PARM1

HYDR-PARM2

# - #	FTABNO	LEN	DELTH	STCOR	KS	DB50	***
<----->	<----->	<----->	<----->	<----->	<----->	<----->	***

END HYDR-PARM2

HYDR-INIT

RCHRES	Initial conditions for each HYDR section	***
# - #	*** VOL	Initial value of COLIND
	*** ac-ft	for each possible exit
		Initial value of OUTDGT
		for each possible exit
<----->	<----->	<----->

END HYDR-INIT

END RCHRES

SPEC-ACTIONS

END SPEC-ACTIONS

FTABLES

END FTABLES

EXT SOURCES

<-Volume->	<Member>	SsysSgap	<--Mult-->	Tran	<-Target vols>	<-Grp>	<-Member->	***
<Name> #	<Name> #	tem	strg	<-factor-->strg	<Name> #	#	<Name> #	***
WDM	2	PREC	ENGL	1	PERLND	1 999	EXTNL	PREC
WDM	2	PREC	ENGL	1	IMPLND	1 999	EXTNL	PREC

```
WDM      1 EVAP      ENGL      0.76          PERLND    1 999 EXTNL  PETINP
WDM      1 EVAP      ENGL      0.76          IMPLND    1 999 EXTNL  PETINP
```

END EXT SOURCES

EXT TARGETS

```
<-Volume-> <-Grp> <-Member-><--Mult-->Tran <-Volume-> <Member> Tsys Tgap Amd ***
<Name>      #      <Name> # #<-factor->strg <Name>      # <Name>      tem strg strg***
COPY      501 OUTPUT MEAN    1 1      48.4      WDM      501 FLOW      ENGL      REPL
END EXT TARGETS
```

MASS-LINK

```
<Volume>   <-Grp> <-Member-><--Mult-->   <Target>           <-Grp> <-Member->***
<Name>     #      <Name> # #<-factor->   <Name>           <Name> # #***
  MASS-LINK      12
PERLND      PWATER SURO           0.083333      COPY           INPUT  MEAN
  END MASS-LINK      12
```

```
  MASS-LINK      13
PERLND      PWATER IFWO          0.083333      COPY           INPUT  MEAN
  END MASS-LINK      13
```

END MASS-LINK

END RUN

# Mitigated UCI File

RUN

GLOBAL

```
WVHM4 model simulation
START      1948 10 01      END      2009 09 30
RUN INTERP OUTPUT LEVEL   3      0
RESUME     0 RUN          1
UNIT SYSTEM 1
```

END GLOBAL

FILES

```
<File> <Un#> <-----File Name----->***
<-ID->                                     ***
WDM      26      WVHM.wdm
MESSU    25      MitWVHM.MES
          27      MitWVHM.L61
          28      MitWVHM.L62
          30      POCWVHM1.dat
```

END FILES

OPN SEQUENCE

```
INGRP          INDELT 00:15
  IMPLND        4
  IMPLND        6
  PERLND        8
  RCHRES        1
  COPY          1
  COPY          501
  COPY          601
  DISPLY        1
```

END INGRP

END OPN SEQUENCE

DISPLY

DISPLY-INFO1

```
# - #<-----Title----->***TRAN PIVL DIG1 FIL1  PYR DIG2 FIL2 YRND
  1   Tank 1          MAX          1   2   30   9
```

END DISPLY-INFO1

END DISPLY

COPY

TIMESERIES

```
# - # NPT NMN ***
  1   1   1
 501  1   1
 601  1   1
```

END TIMESERIES

END COPY

GENER

OPCODE

```
# # OPCODE ***
```

END OPCODE

PARM

```
# # K ***
```

END PARM

END GENER

PERLND

GEN-INFO

```
<PLS ><-----Name----->NBLKS Unit-systems Printer ***
# - # User t-series Engr Metr ***
          in out ***
  8   A/B, Lawn, Mod 1 1 1 1 27 0
```

END GEN-INFO

\*\*\* Section PWATER\*\*\*

ACTIVITY

```
<PLS > ***** Active Sections *****
# - # ATMP SNOW PWAT SED PST PWG PQAL MSTL PEST NITR PHOS TRAC ***
  8   0   0   1   0   0   0   0   0   0   0   0   0
```

END ACTIVITY

```

PRINT-INFO
<PLS > ***** Print-flags ***** PIVL  PYR
# - # ATMP SNOW PWAT  SED  PST  PWG  PQAL MSTL PEST NITR PHOS TRAC  *****
8      0      0      4      0      0      0      0      0      0      0      0      0      0      1      9
END PRINT-INFO

```

```

PWAT-PARM1
<PLS > PWATER variable monthly parameter value flags ***
# - # CSNO RTOP UZFG  VCS  VUZ  VNN VIFW VIRC  VLE INFC  HWT ***
8      0      0      0      0      0      0      0      0      0      0      0
END PWAT-PARM1

```

```

PWAT-PARM2
<PLS > PWATER input info: Part 2          ***
# - # ***FOREST      LZSN      INFILT      LSUR      SLSUR      KVARY      AGWRC
8      0      5      0.8      400      0.1      0.3      0.996
END PWAT-PARM2

```

```

PWAT-PARM3
<PLS > PWATER input info: Part 3          ***
# - # ***PETMAX      PETMIN      INFEXP      INFILD      DEEPFR      BASETP      AGWETP
8      0      0      2      2      0      0      0
END PWAT-PARM3

```

```

PWAT-PARM4
<PLS > PWATER input info: Part 4          ***
# - #      CEPSC      UZSN      NSUR      INTFW      IRC      LZETP ***
8      0.1      0.5      0.25      0      0.7      0.25
END PWAT-PARM4

```

```

PWAT-STATE1
<PLS > *** Initial conditions at start of simulation
ran from 1990 to end of 1992 (pat 1-11-95) RUN 21 ***
# - # *** CEPS      SURS      UZS      IFWS      LZS      AGWS      GWVS
8      0      0      0      0      3      1      0
END PWAT-STATE1

```

END PERLND

IMPLND

```

GEN-INFO
<PLS ><-----Name----->  Unit-systems  Printer ***
# - #      User  t-series  Engl Metr ***
      in  out      ***
4      ROOF TOPS/FLAT      1      1      1      27      0
6      DRIVEWAYS/MOD      1      1      1      27      0
END GEN-INFO
*** Section IWATER***

```

```

ACTIVITY
<PLS > ***** Active Sections *****
# - # ATMP SNOW IWAT  SLD  IWG IQAL  ***
4      0      0      1      0      0      0
6      0      0      1      0      0      0
END ACTIVITY

```

```

PRINT-INFO
<ILS > ***** Print-flags ***** PIVL  PYR
# - # ATMP SNOW IWAT  SLD  IWG IQAL  *****
4      0      0      4      0      0      0      1      9
6      0      0      4      0      0      0      1      9
END PRINT-INFO

```

```

IWAT-PARM1
<PLS > IWATER variable monthly parameter value flags ***
# - # CSNO RTOP  VRS  VNN RTLI      ***
4      0      0      0      0      0
6      0      0      0      0      0
END IWAT-PARM1

```

IWAT-PARM2

```

<PLS >          IWATER input info: Part 2          ***
# - # ***  LSUR      SLSUR      NSUR      RETSC
4          400      0.01      0.1      0.1
6          400      0.05      0.1      0.08
END IWAT-PARM2

```

```

IWAT-PARM3
<PLS >          IWATER input info: Part 3          ***
# - # ***PETMAX    PETMIN
4          0        0
6          0        0
END IWAT-PARM3

```

```

IWAT-STATE1
<PLS > *** Initial conditions at start of simulation
# - # ***  RETS      SURS
4          0        0
6          0        0
END IWAT-STATE1

```

END IMPLND

```

SCHEMATIC
<-Source->          <--Area-->          <-Target->          MBLK          ***
<Name> #          <-factor->          <Name> #          Tbl#          ***
Roof***
IMPLND 4          0.104          RCHRES 1          5
Driveway and walkway to Detention***
IMPLND 6          0.04          RCHRES 1          5
Driveway unmitigated***
IMPLND 6          0.022          COPY 501          15
IMPLND 6          0.022          COPY 601          15
landscaping***
PERLND 8          0.182          COPY 501          12
PERLND 8          0.182          COPY 601          12
PERLND 8          0.182          COPY 501          13
PERLND 8          0.182          COPY 601          13
*****Routing*****
IMPLND 4          0.104          COPY 1          15
IMPLND 6          0.04          COPY 1          15
RCHRES 1          1          COPY 501          16
END SCHEMATIC

```

```

NETWORK
<-Volume-> <-Grp> <-Member-><--Mult-->Tran <-Target vols> <-Grp> <-Member-> ***
<Name> #          <Name> # #<-factor->strg <Name> # #          <Name> # #          ***
COPY 501 OUTPUT MEAN 1 1 48.4          DISPLY 1          INPUT TIMSER 1

```

```

<-Volume-> <-Grp> <-Member-><--Mult-->Tran <-Target vols> <-Grp> <-Member-> ***
<Name> #          <Name> # #<-factor->strg <Name> # #          <Name> # #          ***
END NETWORK

```

```

RCHRES
GEN-INFO
RCHRES          Name          Nexits          Unit Systems          Printer          ***
# - #<-----><----> User T-series          Engl Metr LKFG          ***
in out          ***
1          Tank 1          1          1          1          1          28          0          1
END GEN-INFO
*** Section RCHRES***

```

```

ACTIVITY
<PLS > ***** Active Sections *****
# - # HYFG ADFG CNFG HTFG SDFG GQFG OXFG NUFG PKFG PHFG ***
1          1          0          0          0          0          0          0          0          0
END ACTIVITY

```

PRINT-INFO

```

<PLS > ***** Print-flags ***** PIVL  PYR
# - # HYDR ADCA CONS HEAT SED  GQL  OXRX NUTR PLNK PHCB PIVL  PYR  *****
1      4    0    0    0    0    0    0    0    0    0    1    9

```

END PRINT-INFO

HYDR-PARM1

```

RCHRES  Flags for each HYDR Section          ***
# - # VC A1 A2 A3  ODFVFG for each *** ODGTFG for each  FUNCT  for each
      FG FG FG FG  possible exit *** possible exit  possible exit
      * * * *   * * * *   * * * *   * * * *
1      0 1 0 0    4 0 0 0 0    0 0 0 0 0    2 2 2 2 2

```

END HYDR-PARM1

HYDR-PARM2

```

# - # FTABNO          LEN          DELTH          STCOR          KS          DB50          ***
<-----><-----><-----><-----><-----><-----><----->          ***
1      1          0.01          0.0          309.4          0.5          0.0

```

END HYDR-PARM2

HYDR-INIT

```

RCHRES  Initial conditions for each HYDR section          ***
# - # *** VOL          Initial value of COLIND          Initial value of OUTDGT
      *** ac-ft          for each possible exit          for each possible exit
<-----><----->          <---><---><---><---><--->          *** <---><---><---><---><--->
1      0          4.0 0.0 0.0 0.0 0.0          0.0 0.0 0.0 0.0 0.0

```

END HYDR-INIT

END RCHRES

SPEC-ACTIONS

END SPEC-ACTIONS

FTABLES

FTABLE	1	91	4	Depth (ft)	Area (acres)	Volume (acre-ft)	Outflow1 (cfs)	Velocity (ft/sec)	Travel Time (Minutes)***
0.000000	0.000000	0.000000	0.010054						
0.055556	0.001757	0.000065	0.010238						
0.111111	0.002470	0.000184	0.010419						
0.166667	0.003008	0.000337	0.010598						
0.222222	0.003454	0.000516	0.010773						
0.277778	0.003839	0.000719	0.010945						
0.333333	0.004180	0.000942	0.011115						
0.388889	0.004488	0.001183	0.011282						
0.444444	0.004769	0.001440	0.011447						
0.500000	0.005028	0.001713	0.011609						
0.555556	0.005267	0.001999	0.011769						
0.611111	0.005489	0.002297	0.011927						
0.666667	0.005697	0.002608	0.012083						
0.722222	0.005891	0.002930	0.012237						
0.777778	0.006074	0.003263	0.012389						
0.833333	0.006246	0.003605	0.012539						
0.888889	0.006407	0.003956	0.012688						
0.944444	0.006560	0.004317	0.012834						
1.000000	0.006703	0.004685	0.012979						
1.055556	0.006839	0.005061	0.013123						
1.111111	0.006967	0.005445	0.013265						
1.166667	0.007088	0.005835	0.013405						
1.222222	0.007202	0.006232	0.013544						
1.277778	0.007310	0.006635	0.013681						
1.333333	0.007411	0.007044	0.013818						
1.388889	0.007506	0.007459	0.013952						
1.444444	0.007596	0.007878	0.014086						
1.500000	0.007680	0.008303	0.014218						
1.555556	0.007758	0.008731	0.014349						
1.611111	0.007832	0.009164	0.014479						
1.666667	0.007900	0.009601	0.014608						
1.722222	0.007963	0.010042	0.014735						
1.777778	0.008022	0.010486	0.014862						
1.833333	0.008076	0.010933	0.014987						
1.888889	0.008125	0.011383	0.015112						

```

1.944444 0.008170 0.011836 0.015235
2.000000 0.008210 0.012291 0.015357
2.055556 0.008246 0.012748 0.015479
2.111111 0.008277 0.013207 0.015599
2.166667 0.008304 0.013668 0.015719
2.222222 0.008327 0.014130 0.015837
2.277778 0.008346 0.014593 0.015955
2.333333 0.008361 0.015057 0.016072
2.388889 0.008371 0.015522 0.016188
2.444444 0.008377 0.015987 0.016303
2.500000 0.008379 0.016453 0.016418
2.555556 0.008377 0.016918 0.016531
2.611111 0.008371 0.017383 0.016644
2.666667 0.008361 0.017848 0.016756
2.722222 0.008346 0.018312 0.016868
2.777778 0.008327 0.018775 0.016978
2.833333 0.008304 0.019237 0.017088
2.888889 0.008277 0.019698 0.017197
2.944444 0.008246 0.020157 0.017306
3.000000 0.008210 0.020614 0.017414
3.055556 0.008170 0.021069 0.017521
3.111111 0.008125 0.021522 0.017627
3.166667 0.008076 0.021972 0.017733
3.222222 0.008022 0.022419 0.017838
3.277778 0.007963 0.022863 0.017943
3.333333 0.007900 0.023304 0.018047
3.388889 0.007832 0.023741 0.018151
3.444444 0.007758 0.024174 0.018253
3.500000 0.007680 0.024603 0.018356
3.555556 0.007596 0.025027 0.018457
3.611111 0.007506 0.025447 0.018558
3.666667 0.007411 0.025861 0.018659
3.722222 0.007310 0.026270 0.018759
3.777778 0.007202 0.026673 0.018859
3.833333 0.007088 0.027070 0.018958
3.888889 0.006967 0.027460 0.019056
3.944444 0.006839 0.027844 0.019154
4.000000 0.006703 0.028220 0.019252
4.055556 0.006560 0.028589 0.019349
4.111111 0.006407 0.028949 0.019445
4.166667 0.006246 0.029300 0.019541
4.222222 0.006074 0.029643 0.019637
4.277778 0.005891 0.029975 0.019732
4.333333 0.005697 0.030297 0.019826
4.388889 0.005489 0.030608 0.019921
4.444444 0.005267 0.030907 0.020014
4.500000 0.005028 0.031193 0.020108
4.555556 0.004769 0.031465 0.020200
4.611111 0.004488 0.031722 0.020293
4.666667 0.004180 0.031963 0.020385
4.722222 0.003839 0.032186 0.020477
4.777778 0.003454 0.032389 0.020568
4.833333 0.003008 0.032569 0.020659
4.888889 0.002470 0.032721 0.020749
4.944444 0.001757 0.032840 0.020839
5.000000 0.001000 0.032905 0.020929

```

```

END FTABLE 1
END FTABLES

```

EXT SOURCES

```

<-Volume-> <Member> SsysSgap<--Mult-->Tran <-Target vols> <-Grp> <-Member-> ***
<Name> # <Name> # tem strg<-factor->strg <Name> # # <Name> # # ***
WDM 2 PREC ENGL 1 PERLND 1 999 EXTNL PREC
WDM 2 PREC ENGL 1 IMPLND 1 999 EXTNL PREC
WDM 1 EVAP ENGL 0.76 PERLND 1 999 EXTNL PETINP
WDM 1 EVAP ENGL 0.76 IMPLND 1 999 EXTNL PETINP

```

END EXT SOURCES

EXT TARGETS

```

<-Volume-> <-Grp> <-Member-><--Mult-->Tran <-Volume-> <Member> Tsys Tgap Amd ***
<Name> # <Name> # #<-factor->strg <Name> # <Name> tem strg strg***
RCHRES 1 HYDR RO 1 1 1 WDM 1000 FLOW ENGL REPL
RCHRES 1 HYDR STAGE 1 1 1 WDM 1001 STAG ENGL REPL
COPY 1 OUTPUT MEAN 1 1 48.4 WDM 701 FLOW ENGL REPL
COPY 501 OUTPUT MEAN 1 1 48.4 WDM 801 FLOW ENGL REPL
COPY 601 OUTPUT MEAN 1 1 48.4 WDM 901 FLOW ENGL REPL
END EXT TARGETS

```

MASS-LINK

```

<Volume> <-Grp> <-Member-><--Mult--> <Target> <-Grp> <-Member->***
<Name> <Name> # #<-factor-> <Name> <Name> # #***
MASS-LINK 5
IMPLND IWATER SURO 0.083333 RCHRES INFLOW IVOL
END MASS-LINK 5

```

```

MASS-LINK 12
PERLND PWATER SURO 0.083333 COPY INPUT MEAN
END MASS-LINK 12

```

```

MASS-LINK 13
PERLND PWATER IFWO 0.083333 COPY INPUT MEAN
END MASS-LINK 13

```

```

MASS-LINK 15
IMPLND IWATER SURO 0.083333 COPY INPUT MEAN
END MASS-LINK 15

```

```

MASS-LINK 16
RCHRES ROFLOW COPY INPUT MEAN
END MASS-LINK 16

```

END MASS-LINK

END RUN

*Predeveloped HSPF Message File*

*Mitigated HSPF Message File*

## *Disclaimer*

### *Legal Notice*

This program and accompanying documentation are provided 'as-is' without warranty of any kind. The entire risk regarding the performance and results of this program is assumed by End User. Clear Creek Solutions Inc. and the governmental licensee or sublicensees disclaim all warranties, either expressed or implied, including but not limited to implied warranties of program and accompanying documentation. In no event shall Clear Creek Solutions Inc. be liable for any damages whatsoever (including without limitation to damages for loss of business profits, loss of business information, business interruption, and the like) arising out of the use of, or inability to use this program even if Clear Creek Solutions Inc. or their authorized representatives have been advised of the possibility of such damages. Software Copyright © by : Clear Creek Solutions, Inc. 2005-2024; All Rights Reserved.

Clear Creek Solutions, Inc.  
6200 Capitol Blvd. Ste F  
Olympia, WA. 98501  
Toll Free 1(866)943-0304  
Local (360)943-0304

[www.clearcreeksolutions.com](http://www.clearcreeksolutions.com)